
WATER RESOURCES OF THE MYAKKA RIVER BASIN AREA, SOUTHWEST FLORIDA

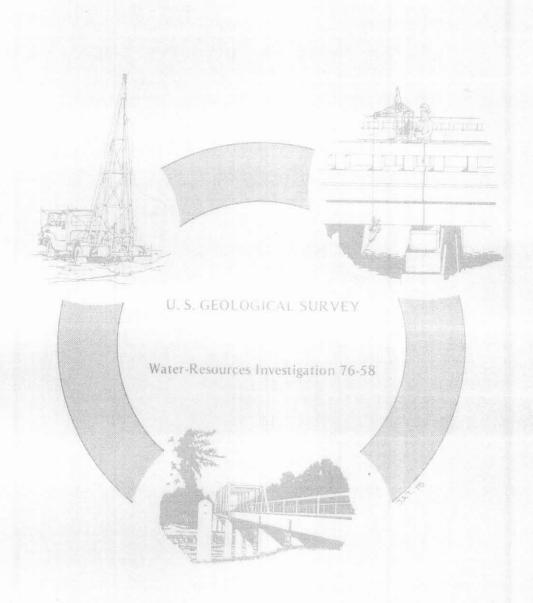

Prepared in cooperation with the BUREAU OF GEOLOGY, FLORIDA DEPARTMENT OF NATURAL RESOURCES, SARASOTA COUNTY, CITY OF SARASOTA, and the FLORIDA DEPARTMENT OF ENVIRONMENTAL REGULATION

BIBLIOGRAPHIC DATA SHEET	1. Report No.	2.	3. Recipient	s Accession No.	
	ER RESOURCES OF THE MYAKE THWEST FLORIDA	A RIVER	Beechiber		
			6.		
7. Author(s) B. F. Joyne	r and H. Sutcliffe, Jr.		8. Performing No. USGS	Gorganization Rept. /WRI 76-58	
9. Performing Organization N U.S.Geological Sur	Name and Address evey, Water Resources Division			Task/Work Unit No.	
325 John Knox Road Suite F-240			11. Contract,	Grant No.	
Tallahassee, Flori					
12. Sponsoring Organization	Name and Address vey, Water Resources Division		13. Type of I Covered	13. Type of Report & Period Covered	
325 John Knox Road	· ·	·	Final	ļ	
Suite F-240			14.		
Tallahassee, Flori					
15. Supplementary Notespre	epared in cooperation with Bur	eau of Geo	ology, Florida De	partment of	
Natural Resources, Environmental Regul	Sarasota County, City of Sara	sota, and	the Florida Depa	rtment of	
fer and from five z generally less than except in coastal a in the Venice area the water is good a quifer in the heav most areas, water in gal/min. Fluoride 1,500 gal/min to la area water from zon Zone 5 is the most usually are too his rived from natural 17. Key Words and Documen *Ground water, *	ter in the Myakka River basing tones in an artesian aquifer. In 50 gal/min and dissolved soluteas and the peninsula southway that tap zone. I usually yield except in the peninsula areas. It is of acceptable quality. Wells concentration ranges from I targe diameter wells. Except in the 4 usually contains high comproductive aquifer in the areas for public supply except in drainage is of good qualityer Analysis. 170. Descriptors Surface water, *Water quality table, Floods, Irrigation	Wells in ids concer est of the less than Zone 2 is Wells yie that tap to 3.5 mg/s in the extraction a, but distinct the extraction is the extraction of the	the water table ntration is less to Myakka River es a 30 gal/min. The the most highly ald as much as 20 zone 3 yield as a 20 zone 4 yields to be fluoride and solved solids come northeast. Surpoccasional high contracts and solved solids come and the solved so	aquifer yield than 500 mg/l stuary. Wells to quality of developed 00 gal/min. In much as 500 as much as a part of the d sulfate. Oncentrations face water descolor in summer.	
17b. Identifiers/Open-Ended	i Terms				
*Zones, *Water problems, Sand, Clay, Tampa, Limestone, *Suwannee Limestone, Ocala Limestone, Hawthorn Formation, Avon Park Formation, Venice Clay					
17c. COSATI Field/Group					
18. Availability Statement			ecurity Class (This Report)	21. No. of Pages 87	
No restriction	on distribution.	20. 5	UNCLASSIFIED ecurity Class (This	22. Price	
		1	Page UNCLASSIFIED		

WATER RESOURCES OF THE MYAKKA RIVER

BASIN AREA, SOUTHWEST FLORIDA

By B. F. Joyner and H. Sutcliffe, Jr.

U.S. GEOLOGICAL SURVEY

Water-Resources Investigations 76-58

Prepared in cooperation with the

BUREAU OF GEOLOGY, FLORIDA DEPARTMENT OF NATURAL RESOURCES, SARASOTA COUNTY, CITY OF SARASOTA, and the FLORIDA DEPARTMENT OF ENVIRONMENTAL REGULATION

ENVIRONMENTAL CONTROL

MAR 7 1978

December 1976

UNITED STATES DEPARTMENT OF THE INTERIOR

Thomas S. Kleppe, Secretary

GEOLOGICAL SURVEY

V. E. McKelvey, Director

For additional information write to:

U.S. Geological Survey 325 John Knox Road Suite F-240 Tallahassee, Florida 32303

CONTENTS

	Page
Abstract	1
Introduction	5
Purpose and scope	5
Acknowledgments	6
Previous investigations	7
Description of the area	8
Location	8
Topography and drainage	8
Hydrology	12
Rainfall and evapotranspiration	13
Ground water	17
Geologic and hydrogeologic units	17
Water-table aquifer	20
The artesian aquifer system	31
Artesian zone-l	32
Artesian zone-2	35
Artesian zone=3	41
Artesian zone-4	44
Artesian zone-5	49
Potentiometric surface	56
Surface water	5 9
Streamflow	59
Water quality	61
	64
Lakes	65
Springs	67
Water use	
Water problems	72
Floods	73
Drainage	74
Supply	75
Contamination	76
Summary	79
Selected references	83
ILLUSTRATIONS	
Figure 1Map showing location of Myakka River basin area 2Map of Myakka River basin area showing principal	9
topographic and drainage features	10
3Graphs showing annual and mean monthly rainfall in	
the Myakka River basin area	14
4Generalized sections A-A', B-B', C-C' and D-D'	- '
showing lithologic units of Oligocene age and	
younger, underlying the Myakka River basin area	21

ILLUSTRATIONS (Continued)

		Page
Figure 5Generalized sections E-E', F-F', and G-G' show-ing lithologic units of Oligocene age and		
younger, underlying the Myakka River basin area 6Map showing location of wells referred to in	•	22
this report and lines of sections	•	23
the water-table aquifer	•	27
wells tapping the water-table aquifer 9Hydrographs of selected observation wells	•	29
tapping Zone-2	٠	37
from wells tapping Zone 2	•	38
wells tapping Zone 3	•	43
tapping Zones 2, 3, 4, and 5	•	46
from Zones 2, 3, and 4	•	47
Warm Salt Springs	•	53
4, and 5 in June 1966	•	57
4, and 5 in November 1966 and area of artesian flow		58
$17. extstyle{}$ Map showing surface-water sampling sites $18. extstyle{}$ Graph of pumpage for the cities of Sarasota		63
and Venice, 1962-66	•	69
TABLES		
Table 1Geologic units penetrated by water wells in the		
Myakka River basin area	•	18
underlying the Myakka River basin area		19
3Analyses of water obtained from two wells that tap Zone 1 in Englewood and Venice area		34
4Analyses of water obtained from a well that	•	
tans Zones 2. 3. and 4		50

TABLES (Continued)

	Page
Table 5Analyses of water from Warm Salt Spring and well 5 6Range in quality of surface water in the Myakka	55
River Basin area	62
area in 1965	68

For use of those readers who may prefer to use metric units rather than English units, the conversion factors for the terms used in this report are listed below

Multiply English unit	Ву	To obtain metric unit
inch (in)	25.4	millimetre (mm)
foot (ft)	.3048	metre (m)
mile (mi)	1.609	kilometre (km)
square mile (mi ²)	2.590	square kilometre (km²)
acre	.4047	hectare (ha)
acre-foot (acre-ft)	.001233	cubic hectometre (hm^3)
gallon (gal)	3.785	litre (1)
gallon per minute (gal/min)	.06309	litres per second $(1/s)$
million gallons per day (Mga	1/d) .04381	cubic metres per second (m^3/s)
cubic feet per second (ft ³ /s)	.02832	cubic metres per second (m^3/s)

WATER RESOURCES OF THE MYAKKA RIVER BASIN AREA, SOUTHWEST FLORIDA

Ву

B. F. Joyner and H. Sutcliffe, Jr.

ABSTRACT

The Myakka River basin area covers about 1,120 square miles (2,900 square kilometres) and includes all of Sarasota County, and parts of Manatee, Charlotte, Hardee, and DeSoto Counties. Most of the area is less than 100 feet (30 metres) above mean sea level. Drainage is poor in much of the area and there are many swamps along the poorly defined stream channels.

Ground water in the Myakka River basin area is obtained from a watertable aquifer and an artesian aquifer system consisting of several parts, referred to in this report as zones 1 through 5. The watertable aquifer is composed of layers of sand, shell, marl and phosphate gravel, intermixed locally with sandy clay. The five zones of the artesian aquifer are as follows: (1) zone-1, semi-consolidated shell, clay, and limestone beds usually at depths less than 70 feet (21 metres) and best defined in the Venice area; (2) zone-2, consolidated clay, sandstone, and limestone of the upper unit of the Hawthorn Formation below a clay layer, which is present only in the coastal area, at depths of about 200 feet (61 metres); (3) zone-3, consolidated clay, limestone, and sandy limestone of the lower 60 to 80 feet (18 to 24 metres) of the Hawthorn Formation and upper part of the Tampa Limestone at depths ranging from 250 to 450 feet (75 to 140 metres); (4) zone-4, the lower part of the Tampa Limestone, Suwannee Limestone and the upper part of the Ocala Limestone between 500 and 700 feet in depth (150 to

210 metres); and (5) zone-5, dense dolomitic limestone and dolomite of the Avon Park Limestone at depths of 1,000 to 1,500 feet (305 to 460 metres) below land surface.

Wells in the water-table aquifer usually yield less than 50 gallons per minute (3.2 litres per second). The dissolved solids concentration of the water is usually less than 500 milligrams per litre, except in coastal areas and the peninsula west of the Myakka River estuary where the the water is highly mineralized.

Yields from wells tapping zone—I are usually no greater than 30 gallons per minute (2 litres per second) in the Venice area. The quality of zone—I water is good except in the peninsula southwest of the Myakka River estuary where the water also is highly mineralized. Water color is sometimes high, especially where direct recharge occurs through beds containing organic materials.

Zone-2 is the most highly developed aquifer in the heavily populated coastal areas. Yields as great as 200 gallons per minute (13 litres per second) can be obtained from wells that penetrate all of zone-2. In most areas, water of acceptable quality can be obtained from zone-2. However, the fluoride or sulfate concentrations in the water from some wells often exceeds recommended limits for drinking water in the area. Chloride concentrations as high as 15,600 milligrams per litre occur in the peninsula southwest of the Myakka River estuary.

Wellstapping zone-3 yield as much as 500 gallons (1,900 litres) per minute. The fluoride concentrations are usually high, ranging from about 1.0 to 3.5 milligrams per litre. Concentrations of sulfate in water from zone 3 often are high in the southern half of the area.

Zone-4 yields as much as 1,500 gallons (5,700 litres) per minute to large diameter wells. Except in the extreme northeastern part of the area the water from zone-4 usually contains high concentrations of fluoride and sulfate.

Zone-5 is the most productive aquifer in the area, but the water is usually too highly mineralized for public supply except in the extreme northeastern part of the area. The mineralization is sufficiently low, however, that the water can be used for irrigation purposes or condenser cooling.

Many non-tidal reaches of streams virtually go dry during the late spring of most years. Floods occur frequently, especially in low-lying areas, but most of the water runs off and cannot be utilized because of a lack of storage.

Surface water derived from natural drainage is of good quality during normal and high flows, except for the occasional occurrence of high color and temperatures of about 32°C (90°F) during the summer. Low stream flows are often supplemented by waters having a high dissolved-concentration derived from irrigation wells and domestic wastes.

Use of ground water in 1965 is estimated to have averaged about 45 million gallons (170,000 cubic metres) per day for municipal, industrial, domestic and irrigation purposes. Use of surface water is estimated to have been about 2.5 million gallons (9,500 cubic metres) per day for public water supply and pasture irrigation.

Water problems in the Myakka area include flooding, excessive drainage, inadequate supply of water of suitable quality, pollution and saltwater intrusion.

INTRODUCTION

Purpose and Scope

The purpose of this report is to describe the occurrence and quality of surface and ground water in the Myakka River Basin area, to report the amount of ground water used as of 1965, and to define current and potential water-resources problems. Although this report presents information about the distribution and variability in the quantity and quality of the water resources, the major emphasis is on the ground-water resources. The report provides background data needed for use in planning more detailed quantitative studies of specific problems. The investigation upon which the report is based began in 1963 under a cooperative program between the Florida Bureau of Geology and the U.S. Geological Survey, later supplemented by the city of Sarasota and Sarasota County. Finalization of the report was supported by the Florida Department of Environmental Regulation.

Stage and discharge records from 54 streamflow stations and records of about 400 wells were collected during 1963-66. The well data include records of water levels, discharge, well construction, and driller and geophysical logs. Twenty-one test wells were drilled as part of the investigation in cooperation with Sarasota County. Water samples were collected for chemical analysis from streams and lakes and from wells. Information on water used for agricultural, industrial, and public supply purposes was obtained from an inventory made in 1965.

Acknowledgments

The authors express their appreciation to the many residents of the area who freely gave information about their wells, and to various public officials, particularly the Sarasota County Commissioners and the city of Sarasota. Acknowledgment is made of the cooperation received from Smalley, Wellford and Nalven, consulting engineers to Sarasota County. Recognition is also expressed to the Sarasota County Agricultural Extension Agent and the Health Departments of Sarasota and Manatee Counties for their enthusiastic interest and cooperation. Information on irrigation of croplands in Sarasota County was furnished by Mr. Jack Zilles, U. S. Soil Conservation Service, and for Manatee County by Mr. Thomas Greenawalt, County Agricultural Extension Agent.

The Sarasota County Board of Public Instruction, General Development Corporation, Florida Department of Transportation, Manatee County Highway Department, and Mr. Albert Blackburn gave permission to drill and maintain observation wells on their properties. Several well drillers furnished geologic and hydrologic data, permitted collection of water samples and rock cuttings, and made measurements of water levels during drilling operations; grove owners and ranchers furnished data on water use for irrigation.

Previous Investigations

The water resources of the area are described in numerous publications. Stringfield (1933) made a brief investigation of the ground-water resources of Sarasota County in 1931 and 1932. Peek (1958) investigated the ground-water resources of Manatee County and measured the water levels in many wells in Sarasota County during his study. Bishop (1960) reported on the fresh-water resources of Sarasota County. Smith and Gillespie (1960), consulting engineers, prepared an interim report on ground water for the city of Sarasota. Smalley, Wellford, and Nalvern (1961 and 1963) consulting engineers, prepared two reports for the Sarasota County Commissioners. Flippo and Joyner (1968) described the low-flow characteristics of streams in the basin. A brief summary of their findings is presented in this report.

Other investigators have included parts of the Myakka River basin area in geologic and hydrologic studies. Stringfield (1966) reported on artesian water in Tertiary limestone in the southeastern United States. Collins and Howard (1928), Black and Brown (1951), Wander and Reitz (1951), and the Florida State Board of Health (1960, 1964) give information about the chemical quality of water in the area. The reference list at the end of this report includes other investigations for the area.

DESCRIPTION OF THE AREA

Location

The Myakka River basin area covers about 1,000 mi² (2,590 km²) of land and about 120 mi² (310 km²) of bays and keys bordering the Gulf of Mexico in southwestern Florida (fig. 1). The area includes all of the Myakka River basin, part of the Peace River basin north of Charlotte Harbor, and about 20 small coastal basins and keys between Charlotte Harbor and the city of Sarasota. The north and east boundaries are roughly coincident with the Myakka River basin drainage divide.

Topography and Drainage

Most of the Myakka River basin area is in the Coastal Lowlands topographic region of Florida (Cooke, 1945, p. 8), in the Atlantic Coastal Plain Province. About 11 mi² (29 km²) in the extreme headwaters of the Myakka River basin is in the Central Highlands region.

The topography of the area is characterized by a series of gently sloping marine terraces which were developed during former stages of sea level. Maximum altitude is 116 ft (35 m) in the northeast part of the area where the oldest terraces have been dissected into low rolling hills. The southwestern half of the area is less than 20 ft (6 m) above sea level (fig 2) and has little local relief.

The larger streams and canals that make up the drainage system of the Myakka River basin area are shown in figure 2. The natural stream channels form a poorly developed drainage system. Large swampy areas border many channels.

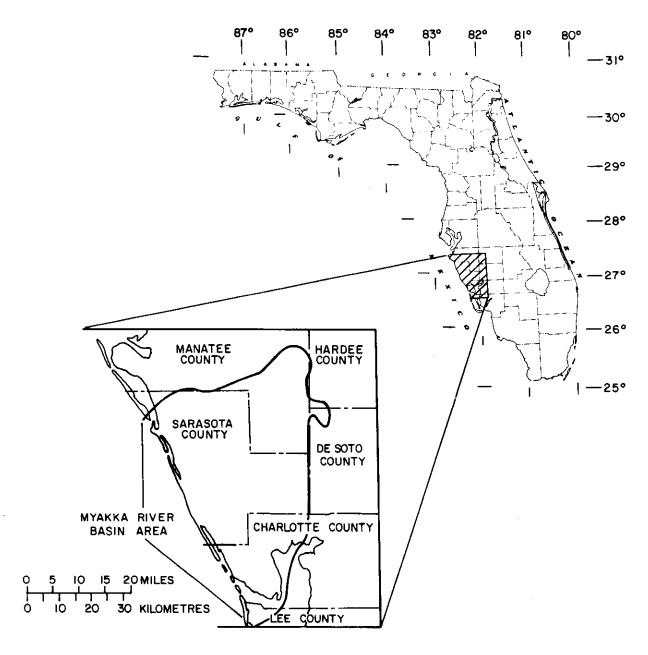


figure 1.--location of myakka river basin area.

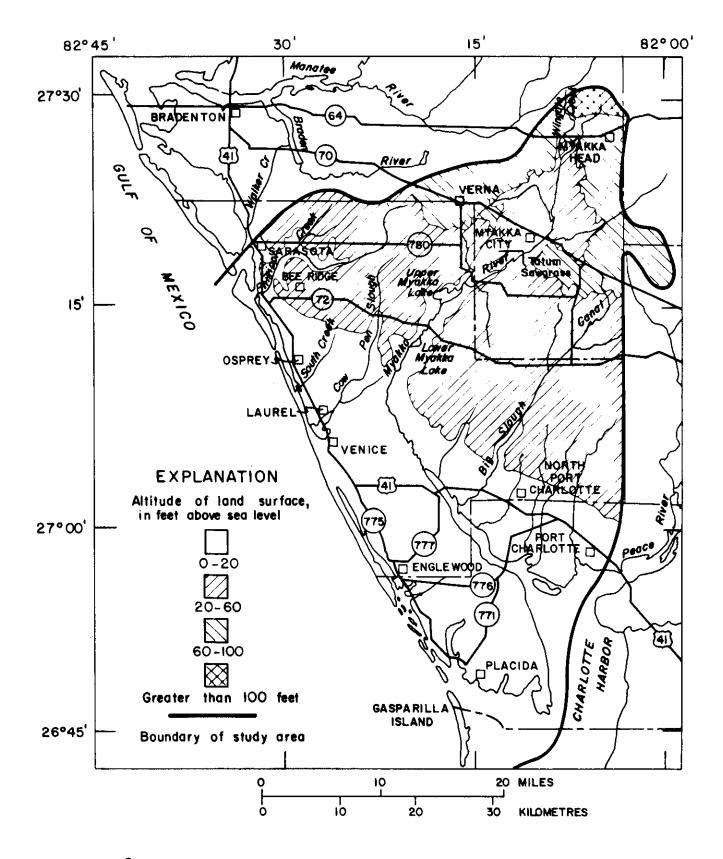


FIGURE 2.--PRINCIPAL TOPOGRAPHIC AND DRAINAGE FEATURES.

In the broad flatlands most natural drainageways are shallow sloughs which range in width from a few feet to more than one mile. The Myakka River channel is the only one that is well defined and naturally entrenched throughout its course. Some of the coastal areas, including most of the keys, are just above sea level and have no recognizable stream channels.

Many sloughs and swampy areas have been drained by ditches and canals. The agricultural areas in the upper Big Slough, Phillippi Creek, and Cow Pen Slough basins, and the recently developed residential areas, such as Port Charlotte, have undergone extensive drainage changes.

Below an altitude of about 60 ft (18 m), hundreds of shallow depressions dot the landscape. Few of these depressions are the sites of perennial ponds or lakes, but all, unless drained by canals, hold water during wet weather.

The Upper and Lower Myakka Lakes are the largest lakes in the area and have a combined water surface of about 1,380 acres (558 ha²) at lake levels of 13.6 and 9.9 ft (4.1 and 3.0 m) above msl respectively. The Tatum Sawgrass, a 4,300-acre (1740 ha²) marsh several miles northeast of Upper Myakka Lake, is several feet above the normal lake level (15-20 ft or 5 - 6 m above msl). This marsh is flooded only when rainfall is exceptionally heavy.

HYDROLOGY

The source of all fresh water in the Myakka River basin area is rain falling either on the immediate area or on adjacent areas.

Most of the rain that falls on the area evaporates. The rest begins to move toward the sea either over land or beneath the ground surface. The water that remains on the surface may be stored temporarily in lakes, ponds, or sloughs, or may flow in streams toward the sea. The water that filters into the ground and reaches the zone of saturation becomes ground water. Rain falling through the atmosphere picks up small quantities of dust particles, atmospheric gases, exhaust gases, and wind-blow salts which affect the water quality.


When rain reaches the earth, it begins to dissolve or pick up in suspension some of the materials contacted. The extent of solvent action depends largely upon the type of mineral contacted, its susceptibility to chemical and physical attack, contact time, and the chemical composition of the water itself. Surface waters in the Myakka River basin area generally contain only small amounts of dissolved solids. They are often highly colored from contact with leaves and other decaying vegetation in swampy areas and stream channels. Ground water on the other hand, is usually low in color, but contains an appreciable amount of salts dissolved from earth materials.


Rainfall and Evapotranspiration

The unweighted average mean annual rainfall for 33 years at 6 stations in and near the Myakka River basin area is 54.3 in (1380 mm) (fig. 3). Rarely is annual rainfall less than 40 in (1,020 mm) or more than 70 in (1,790 mm).

Rainfall shows a marked seasonal distribution, about 60 percent of the annual rainfall occurs in June through September (fig. 3). Most of the summer rainfall is associated with convective thunderstorms that are usually localized, of short duration, and produce high-intensity rainfalls. Tropical depressions and hurricanes may produce heavy rainfall lasting several days during the summer and fall. Hurricane records (U. S. Army, Corps of Engineers, 1961, p. 18) indicate that on the average there is about a 20 percent chance that a hurricane will pass within 50 mi (80 km) of Sarasota each year.

The dry season is from October to May. Often, in the late spring, no measurable rainfall will occur for 60 days or more. The dry season is the irrigation season for truck crops and citrus and also the period of peak population in this area. Therefore, October to May is the time of high water use and water consumption.

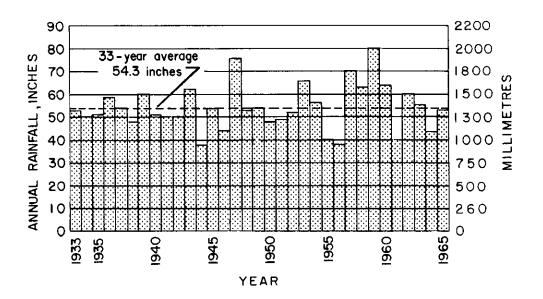

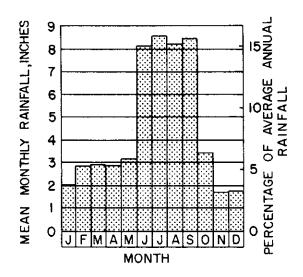

Rainfall of Myakka River basin area computed from rainfall records (unweighted) collected by the U.S. Weather Bureau at Arcadia, Bradenton, Punta Gorda, Sarasota, Wauchula, and Myakka River State Park.

FIGURE 3. -- ANNUAL AND MONTHLY RAINFALL IN THE MYAKKA RIVER BASIN AREA.

A wide range of rainfall conditions occurred during the investigation. The storm of September 20-21, 1962, which occurred before most project stream-gaging stations were in operation, produced a 2-day rainfall of such magnitude as may be expected only once every 20 to 60 years (Miller, 1944). Widespread flooding resulted from this heavy rainfall. On the other hand, the areal rainfall for December 1964 to May 1965 was 29 percent of the mean, resulting in a mild drought.

The amount of water lost to evaporation and transpiration in humid areas, such as the Myakka River basin area, is largely a function of air temperature. Data collected by the National Weather Service indicate that the mean annual air temperature in the Myakka River basin area is about 73.2°F (22.9°C). The annual means at the various temperature recording stations in the area are all within 1.2°F (0.7C) of the areal mean. Mean daily temperatures range from 84°F (29°C) in summer to 61°F (16°C) in winter. Temperatures as high as 104°(40°C) and as low as 19°F (-7.2°C) have been reported.

Temperatures below 32°F (0°C) may be expected about 2 to 4 times each

Temperatures below 32°F (0°C) may be expected about 2 to 4 times each winter; the frequency depends upon the location within the area.

Along the coast, temperatures are slightly higher in the winters and lower in the summers than they are in the interior.

The moderately high temperatures result in a large amount of evapotranspiration. Average annual evapotranspiration is estimated to be 35-40 in (89-102° mm), based on the difference between rainfall (about 54 in or 1,370 mm) and runoff (about 14 in or 360 mm) plus ground-water:recharge (about 1 in or 25 mm). Average annual lake evaporation is estimated to be 52 in (1,320 mm) (Kohler and others, 1959, pl. 2), and evapotranspiration losses from the numerous predominately wet-weather vegetation-filled ponds in the area probably exceeds 60 in (2,800 mm) a year.

Ground Water

Geologic and Hydrogeologic Units

In the Myakka River basin area, ground water occurs both under artesian and nonartesian (water-table) conditions. An aquifer is under artesian conditions when the water is confined; that is, when water levels in wells that tap the aquifer stand above the top of the aquifer. The water in the artesian aquifers is confined above and below by relatively impermeable beds. Nonartesian, or water-table, conditions occur where the upper surface of the zone of saturation, the water table, is unconfined, and is at atmospheric pressure. The water levels in wells tapping the water-table aquifer are, in general, at the same height as the water table.

The Myakka River basin area is underlain by deposits of clastic rocks such as sand, clay, marl, and gravel, of late Tertiary and Quaternary age. These deposits are, in turn, underlain by limestone and dolomite (Table 1). Water in the clastic deposits is contained in the spaces between the constituent grains, whereas much of the water in the limestone and dolomite occurs in fractures and solution cavities. These fractures and solution cavities in limestone and dolomite are best developed in zones that are at or near the contacts between the formations. Each of these zones is normally not more than 40 ft (12 m) thick, and they may overlap a formation boundary and encompass parts of two geologic units. In all, five such zones are recognized in the Myakka River basin area. Their relation to the geologic units is summarized in table 2. The lowermost of these five zones, numbers 3 through 5, together with their confining beds, constitute the

Table 1.--Geologic units penetrated by water wells in the Myakka River basin area.

System	Series	Formation	Characteristics	Thickness (feet)
Quarternary	Pleistocene and Holocene	Surface sand and terrace deposits	Sand and sandy clay, fossi- liferous, alluvial deposit.	0 - 100
	Pleistocene	Caloosahat- chee Marl	Limestone, sand, and gravel quartz and phosphate, fossiliferous, including bone fragments.	0 - 10
Tertiary and Quater- nary	and	Bone Valley Formation	Sand and gravel, quartz and phosphate, clayey, fossiliferous, including bone fragments.	0 - 200
Te	Pliocene	Tamiami Formation	Clay, green, sandy; clay, green and gray; limestone, tan; sandstone, gray; phosphate pebbles abundant near base. Local dark-gray waxy clay ("Venice Clay") at base.	0 - 50
	eue	Hawthorn Formation	Clay and limestone, gray green and blue, phosphatic; interbedded with fossiliferous, sandy limestone, silt and sand.	200 - 400
	Miocene	Tampa Limestone	Limestone, white gray, and tan, sandy, generally hard, dense, phosphatic, partly silicified, fossiliferous, solution cavities.	100 - 300
	Oligocene	Suwannee Limestone	Limestone, light-colored, granular, soft to hard, porous, crystalline, dolomitic, very fossiliferous.	120 - 420
	Eocene	Ocala Limestone	Limestone, light-colored, granular, soft, chalky, interbedded with porous, hard, dense, fossiliferous limestone and thick, brown, crystalline, dolomitic limestone.	300 - 400
	Eoc	Avon Park Limestone	Limestone, light-colored, tan and brown, granular, soft to hard, very porous, interbedded with fossiliferous, crystalline limestone and dolomitic limestone.	600 - 700

Table 2.--Zonal subdivision of the artesian aquifer system underlying the Myakka River basin area.

		Geologic Unit	Use	Well Yields
	1	Tamiami Formation	Widely used in the Venice-Englewood area for domentic and public supplies; elsewhere usually cased off.	Up to 150 gal/min.
		"Venice Clay"	Confining layer	
	2	Upper unit of the Hawthorn Forma- tion	Highly developed in coastal area for domestic, public supply and home irrigation.	Upper part, 25-30 gal/min. Lower part, up to 200 gal/min
[Confining layer	
and others,	3	Lower unit of the Hawthorn Forma- tion.	Widely used for irri- gation.	Average, 250 gal/min Up to 500 gal/min
Parker and		Tampa Limestone		
Par		_	Confining layer	
(as defined by]	4	Suwannee Limestone	Widely used for irrigation.	500-1,500 gal/min
def				
aquifer", (as		Ocala Limestone	Confining layer	Yields little water
ipal ian idan	<u>5</u>	Avon Park Limestone	Used only where large yields needed, mostly for irrigation.	1,500-2,000 gal/min

The depth at which any particular rock unit and corresponding water-bearing zone is encountered varies widely over the area because of variations in the thickness and dip of the units. These variations are illusted on the sections shown on figures 4 and 5. The location of the sections is shown on figure 6. The wells for which data are included in this report have been numbered serially. The U.S. Geological Survey Site Identification Number for each of these wells is listed in a table at the end of the report. The formation contacts were determined from electric and gamma-ray logs of wells and verified by examination of cuttings from key wells. The sections show that the formations generally dip to the southwest; but local variations in dip occur. The variations may be due in part to faulting, but structural control data are insufficient to determine the presence or position of actual faults.

The deeper units are not shown on the sections because of insufficient data. The Avon Park Formation, the upper part of the deepest water-bearing zone penetrated by wells, ranges from about 1,000 feet (300 m) below land surface in the north and east to about 1,500 feet (460 m) below in the south and west.

Water-Table Aquifer

The water-table aquifer consists of Quaternary deposits, the Caloosahatchee Marl, and the Bone Valley Formation of Pleistocene and Pliocene age. It underlies the entire basin and consists of layers of sand,
shells, marl, phosphate gravel, and organic material intermixed locally
with sandy clay. The aquifer ranges in thickness from a few feet along
the coast and on the keys to more than 100 ft (30 m) in the eastern part

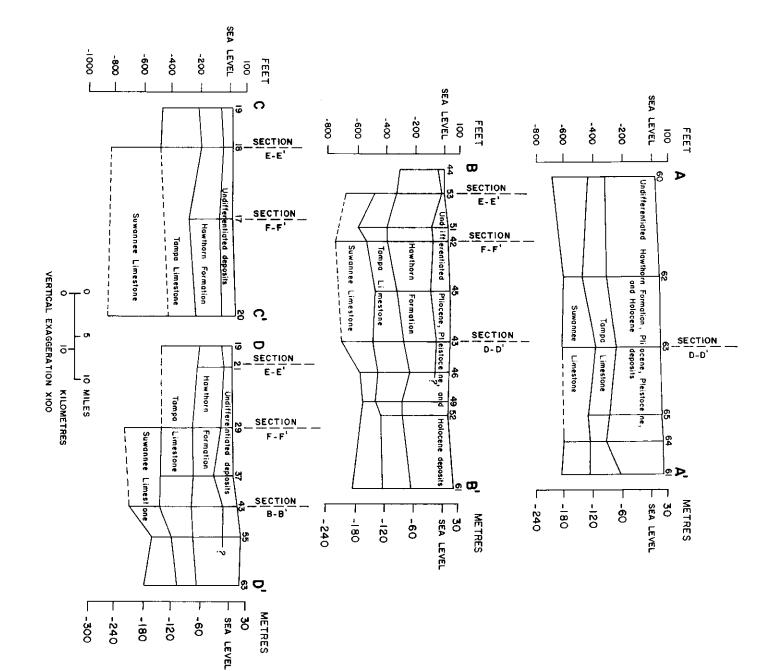


FIGURE 4,--GENERALIZED SECTIONS A-A', B-B', C-C', AND D-D' SHOWING LITHOLOGIC UNITS OF OLIGOCENE AGE AND YOUNGER, UNDERLYING THE MYAKKA RIVER BASIN AREA. (LOCATION OF SECTIONS SHOWN ON FIG. 6.)

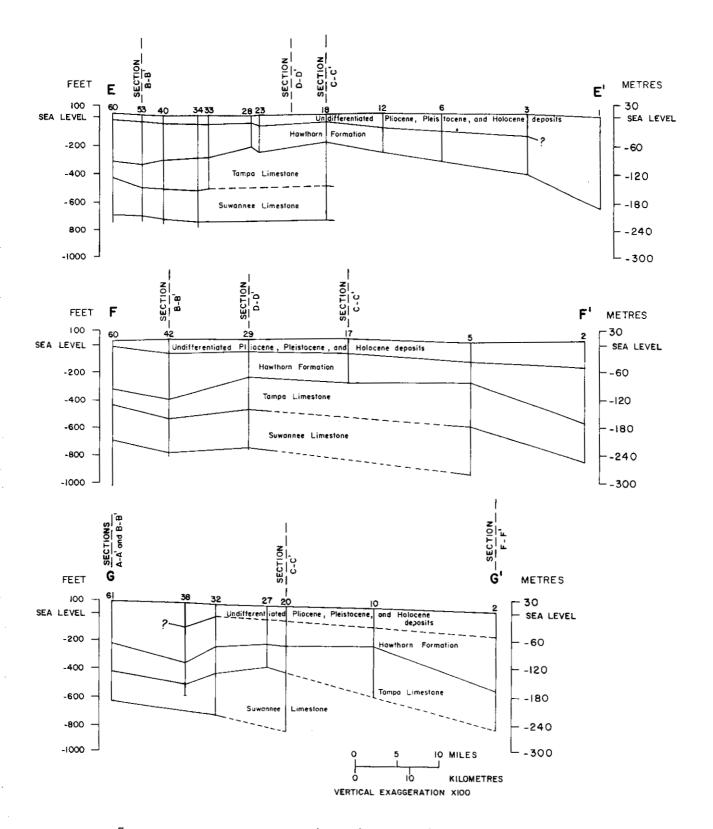


FIGURE 5.--GENERALIZED SECTIONS E-E', F-F', AND G-G' SHOWING LITHOLOGIC UNITS OF OLIGOCENE AGE AND YOUNGER, UNDERLYING THE MYAKKA RIVER BASIN AREA, (LO-CATION OF SECTIONS SHOWN ON FIG. 6.)

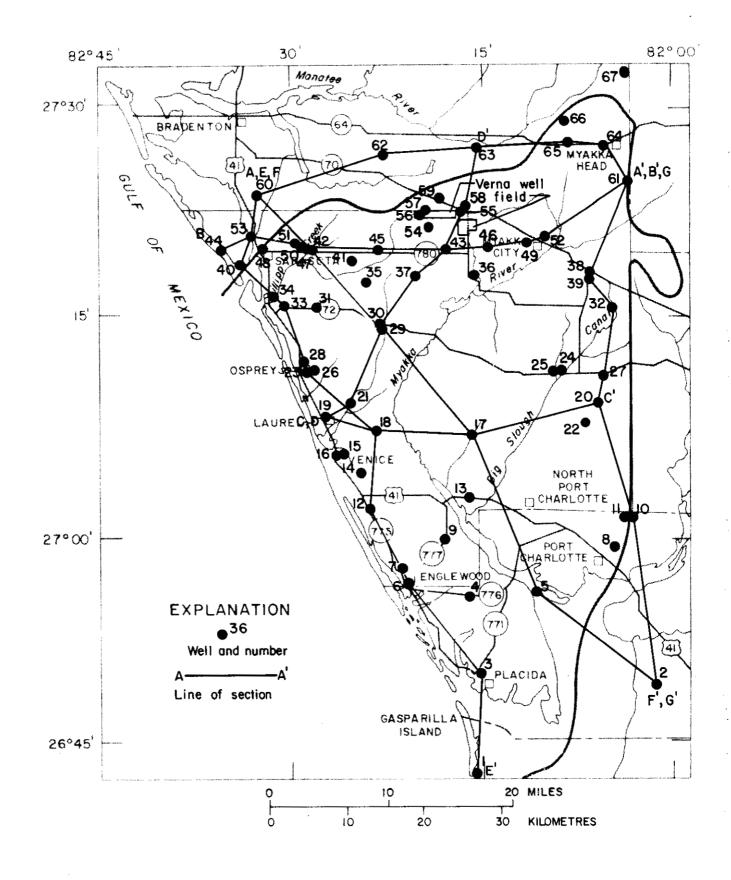


FIGURE 6.--LOCATIONS OF WELLS REFERRED TO IN THIS REPORT AND LINES OF SECTIONS

of the area, and has a wide range of productivity related to the type of the materials of which it is composed.

The water-table aquifer was virtually undeveloped in 1966 yet has the greatest potential as a dependable water supply because of the east with which it can be recharged by precipitation. It also has the greatest potential for contamination from surface sources. Most of the wells that tap the water-table aquifer are small-diameter drive-point wells, particularly in the interior of the basin. Limited use is made of the water-table aquifer on some of the keys where several wells often are installed for a single supply. By the use of several widely spaced low-yield wells instead of one well with a high yield, drawdown in an individual well can be reduced; this is an important consideration in the control of saltwater intrusion into the aquifer. Many small-diameter drive-point wells are used for watering livestock. A few irrigation wells, 3 to 4 in (76 to 100 mm) in diameter are

completed with open end. Some of these wells yield as much as 50 gal/min (3 1/s). Yields of as much as 100 gal/min (6 1/s) could be obtained from screened or gravel pack wells.

The water-table aquifer is recharged locally under both natural and artificial conditions. Natural recharge occurs as direct infiltration of rainfall and as upward leakage from the underlying artesian aquifers where the altitude of the potentiometric surface of the artesian aquifer is higher than that of the water-table aquifer. Recharge also occurs as influent seepage from streams that are at high stage. Artificial recharge occurs from streams ponded behind control structures, infiltration of irrigation water, discharge from septic tanks and the infiltration of water from uncapped flowing wells.

Discharge from the water-table aquifer occurs under both natural and man-induced conditions. Natural discharge occurs by evapotranspiration; seepage into ponds, canals, and streams; and downward leakage in the underlying aquifers. Downward leakage can take place only where the water table is higher than the potentiometric surface of the underlying artesian aquifers. Man-induced discharge results from pumping from wells and draining of water into deep ditches constructed in the agricultural areas to control the depth to the water table.

The depth to the water table in the Myakka River basin area ranges from less than 1 ft (0.3 m) to more than 15 ft (4 m) below land surface. In most places the depth to the water table is less than 8 ft (2.5 m) due to the low topographic relief of the basin. In the extreme northern and northeastern parts of the basin, adjacent to well-defined drainage channels, the water table may be more than 15 ft (4 m) below land surface, particularly during exceptionally dry periods. The water table lies fairly close to land surface on the keys.

Water levels in the wells that tap the water-table aquifer generally fluctuate seasonally in response to variations in recharge and discharge. That is, the water levels decline to a low during the dry spring months and recover generally during the wet summer months to a seasonal high. Water-level fluctuations shown on figure 7 are characteristic of the water-table aquifer.

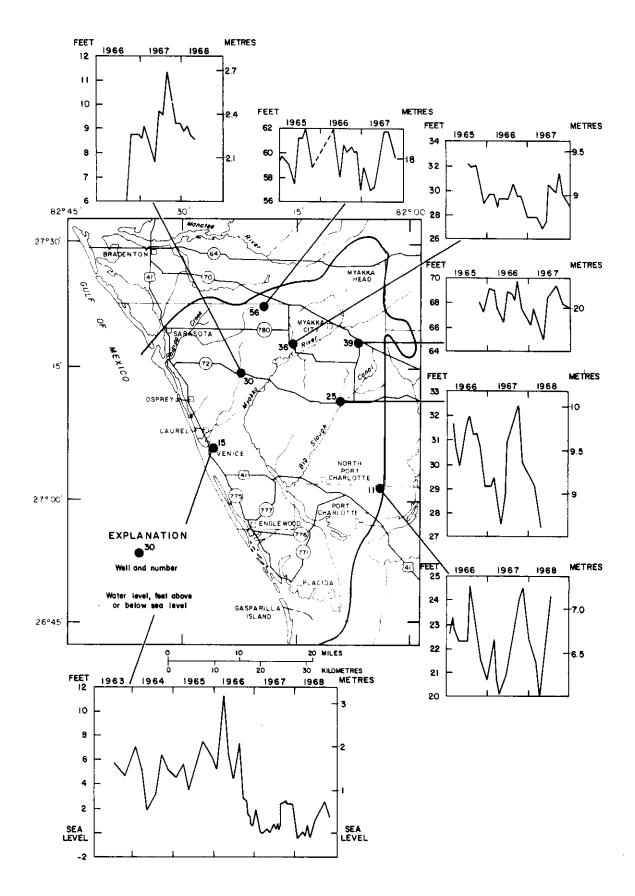


FIGURE 7.--HYDROGRAPHS OF SELECTED OBSERVATION WELLS TAPPING THE WATER-TABLE AQUIFER.

Water obtained from the aquifer is generally of acceptable quality except where saltwater intrusion has taken place near the coast and in the peninsula south and west of the Myakka River estuary (fig. 8). The water in the interior part of the area of investigation generally meets the criteria of the EPA (Environmental Protection Agency) for public water supply (National Academy of Sciences and National Academy of Engineering, 1973). Some constituents in raw water in the peninsula and coastal areas occur in concentrations that exceed these criteria. The principal problem constituents and the EPA criteria are listed below:

Water-quality criteria for selected constituents

Constituent	Recommended limit (mg/1)
Sulfate	250
Chloride	250
Fluoride	1.6
Iron	.3
Color	a75

a Platinum-cobalt units

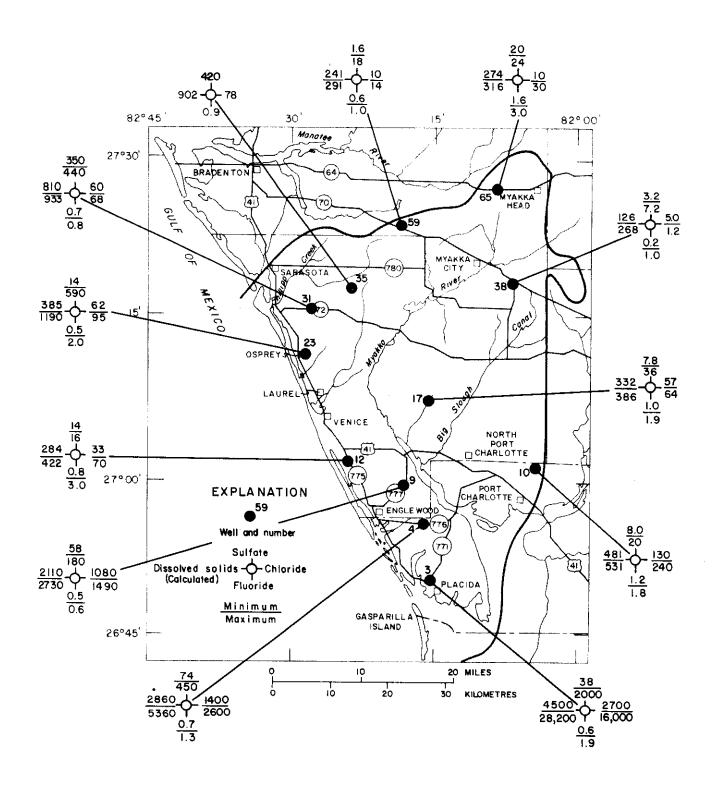


FIGURE 8.--CHEMICAL QUALITY OF WATER FROM WELLS TAPPING THE WATER-TABLE AQUIFER

Most water in the water-table aquifer underlying the peninsula and along the coast is highly mineralized (fig. 8). Chemical characteristics of the water from well 3 near Placida indicate intrusion of saltwater. In well 9, which is 5 mi (8 km) inland from the Gulf, chloride and dissolved-solids concentrations of the water are also above the recommended limits for drinking water. This well, however, may be contaminated by leakage from an artesian aquifer. In many places along the coast, the dissolved-solids concentration of water from wells approaches that of seawater. However, a few wells in shell beds on the Keys yield small quantities (5-10 gal/min or 0.3-0.6 1/s) of potable water. Some wells that tap the shallow shell and sand beds south of Sarasota yield water with about 2 mg/1 of iron.

Well 7 at Englewood and well 13 (fig. 6) near U.S. Highway 41 at the Myakka River are public-supply wells for the Englewood Water District and a private utility, respectively. Except for a color of 100 units, water from well 7 is of excellent quality. Water from well 13 contains high concentrations of iron (1.42 mg/1), dissolved solids, sodium, and chloride. The high sodium and chloride concentrations indicate saltwater intrusion from the Myakka River estuary or from the stream draining Warm Mineral (Salt) Springs. Well 13 is being pumped at a rate of 66 gal/min (4.2 1/s).

Artesian Aquifer System

In the Myakka River basin area, the artesian aquifer system is composed of five separate and distinct producing zones. These zones have been identified in the rock sequence between the base of the water-table aquifer and the base of the Avon Park Limestone (table 2). The identification of these zones is based on their stratigraphic position, lithology, productivity, water level, and the chemical quality of the water produced from them. Test-drilling procedures developed for this study permit identification of the producing zones (Sutcliffe and Joyner, 1968); the zones were further defined by test drilling in Sarasota's well field near Verna and by the use of packer tests as described by Sutcliffe and Joyner (1966). Zones 3 through 5 are in that part of the limestonedolomite sequence that is occupied by the Floridan aquifer elsewhere in the State, except that, in general, the base of the Floridan aquifer, as defined by Parker and others (1955), includes parts or all of the Avon Park and Lake City Limestones. In the Myakka area, no wells have penetrated the Lake City Limestone. The upper part of the Hawthorn Formation where here includes zone-2 (table 2) generally is not considered a part of the Floridan aquifer at other locations in the State.

The separate zones are difficult to distinguish using water-level, productivity and water-quality information from production wells, because most of these wells are cased only to the first hard-rock stratum, usually to depths less than 200 ft (61 m). Thereafter, the wells are usually open hole through more than one zone, and the water pumped from the wells

comes from all zones penetrated by the open hole. As a result, information obtained as the well is being drilled and changes observed as the well enters each zone better define the characteristics of each zone and the differences between zones than information obtained after completion of the well. Every effort was made to collect data from wells as they were being drilled and these data, along with those from the previously mentioned testing programs, were used to define the following artesian zones.

Artesian Zone-l

Zone-1 consists of the semiconsolidated shell, clay, and limestone beds of the Tamiami Formation which lie between the base of the Bone Valley Formation and the so-called "Venice Clay" of local usage. The "Venice Clay" is in the lower part of the Tamiami Formation. The zone underlies the coastal area from Sarasota to Placida and extends inland 10 to 12 mi (16 to 19 km). This zone is widely used in the Venice area for domestic and public supplies. Wells 2 to 3 in (50 to 75 mm) in diameter that are equipped with centrifugal pumps produce as much as 30 gal/min (1.9 1/s) from the zone. The water level of zone-1 is generally less than 10 ft (3 m) below land surface except on the highest ridges.

Water Quality. -- Water of acceptable quality for domestic and public supply is obtained from wells, that tap zone-1 except in the peninsula south and west of the Myakka River estuary. The following table lists some constituents and their concentrations in water from well 42 near Phillippi Creek and well 3 at Placida, on the peninsula. The locations of both wells are shown on figure 6. The table shows the contrast in chemical quality.

Constituent	Well 42 (Concentrations in	Well 3 milligrams per litre)
Dissolved solid	380	a27,000
Sulfate	4	1,900
Chloride	35	15,000
Fluoride	.5	.6
Hardness	290	5,000

a estimated

High concentration of several constituents in the water from well 3 makes it unsuitable for most purposes. Water from well 42 is chemically similar to water from other test wells at Osprey and in the south-central part of the study area that tap zone-1. Water samples from all the wells there meet the EPA criteria for public water supplies. In a sample from well 12 (fig. 6) dissolved solids concentration was 580 mg/1. High color in water from well 12--45 units--is probably caused by the water moving downward through the overlying shell beds to the recharge zone. These shell beds are rich in organic material.

Some of the wells supplying Englewood, Venice and two subdivisions in the Venice area produce water from zone-1. Except for high color, this water is of good quality. Analyses of water from wells 6 and 14, tapping zone-1 in the Englewood and Venice areas are listed in table 3.

TABLE 3.--Analyses of water from wells 6 and 14, tapping Zone-1 in the Englewood and Venice area. (Analyses by U.S. Geological Survey; in milligrams per litre except specific conductance, pH, and color.)

Well	6	14
Date of collection	January 7, 1965	January 8, 1965
Depth of well (feet)	82.5	64
Silica (SiO ₂)	16	22
Iron (F _e)	.06	.11
Calcium (Ca)	96	72
Magnesium (Mg)	6.2	55
Sodium (Na)	25	37
Potassium (K)	1.6	1.4
Bicarbonate (HCO ₃)		
Sulfate (SO ₄)	.0	.0
Chloride (C1)	50	130
Fluoride (F)	.0	.0
Nitrate (NO ₃)	.0	.0
Phosphate (PO ₄)	2,3	.0
Dissolved solids		
Calculated	340	557
Residue	408	
Hardness	265	405
Specific conductance (micromhos/cm at 25°C)	561	1,040
рН	7.5	7.5
Color	40	40

Artesian Zone-2

Zone-2 is the most highly developed artesian zone in the populous coastal area. It furnishes most of the water used for domestic, home irrigation, and public water supplies. Zone-2 consists of the permeable beds in the upper unit of the Hawthorn Formation. These beds underlie the area at depths ranging from 65 to 250 ft (20 to 76 m) below land surface. The zone thickens toward the southeast. The zone is overlain by the so-called "Venice Clay" of the lower part of the Tamiami formation wherever the clay is present. Elsewhere the zone includes the lower part of the Tamiami Formation and is overlain by deposits which have low permeability.

Along the coast, zone-2 is tapped by 22 public water-supply wells. The city of Sarasota derives about two-thirds of its average daily pumpage of 3.86 Mgal/d (15,000 $\rm m^3/d$) from the zone. The zone is also the source of 40 percent (0.2 Mgal/d) (800 $\rm m^3/d$) of city of Venice's average daily pumpage. Because other public supply systems use wells that produce from zones 1 and 2, the quantity of water being produced from zone 2 alone is difficult to estimate.

Small-diameter wells (2 in or 50 mm), that tap only the upper part of the zone may produce 25 to 30 gal/min (1.6 to 1.9 1/s). Higher yields are generally obtained from wells pentrating more of the zone. Larger wells (up to 6 in or 160 mm in diameter) that fully penetrate the zone produce as much as 200 gal/min (13 1/s) with about 20 ft (6 m) of drawdown.

The water level in zone-2 fluctuates in response to withdrawals. In areas where withdrawal is concentrated, such as in the housing subdivisions near the coast, water levels may decline 20 ft (6 m) or more during extended dry periods. This decline has caused many domestic users to be without water when the water level in their wells drop below the lift capacity of the shallow-well pumps. Even in rural areas, water levels in zone-2 may fluctuate substantially (fig. 9) in response to pumping of irrigation wells.

The level in well 35, near a housing subdivision, declined about 24 ft (7 m) from early fall of 1966 to spring of 1967. The level in well 24, in a rural area, declined about 5 ft (1.5 m) during the same period.

Water-Quality--Water-quality deteriorates with increasing depth within zone-2. The maximum and minimum concentrations of selected chemical constituents in water sampled collected during drilling test wells are shown on figure 10. In some areas, fluoride, chloride, and sulfate concentrations exceed the recommended standards for public supply (table 2b). So, these constituents are usually the controlling factors in determining the potability of the water in this zone. Chloride concentrations are excessive only in the peninsula southwest of the Myakka River estuary.

Fluoride in concentrations greater than 1.6 mg/l occur throughout zone-2 in the extreme part of the study area, and in the lower part of this zone in the southwestern part of the area. In water samples collected from zone-2 from test well 65, near Myakka Head, fluoride was at least

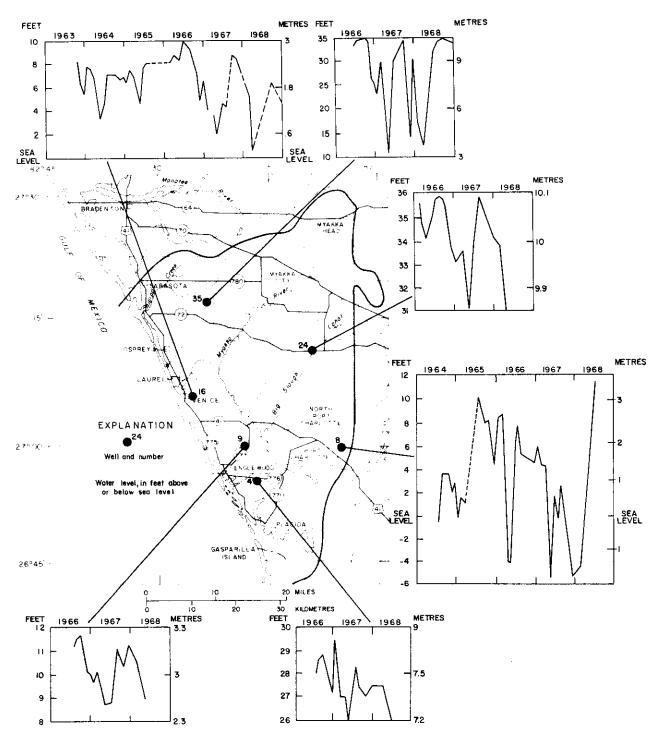


FIGURE 9.--HYDROGRAPHS OF SELECTED OBSERVATION WELLS TAPPING ZONE-2

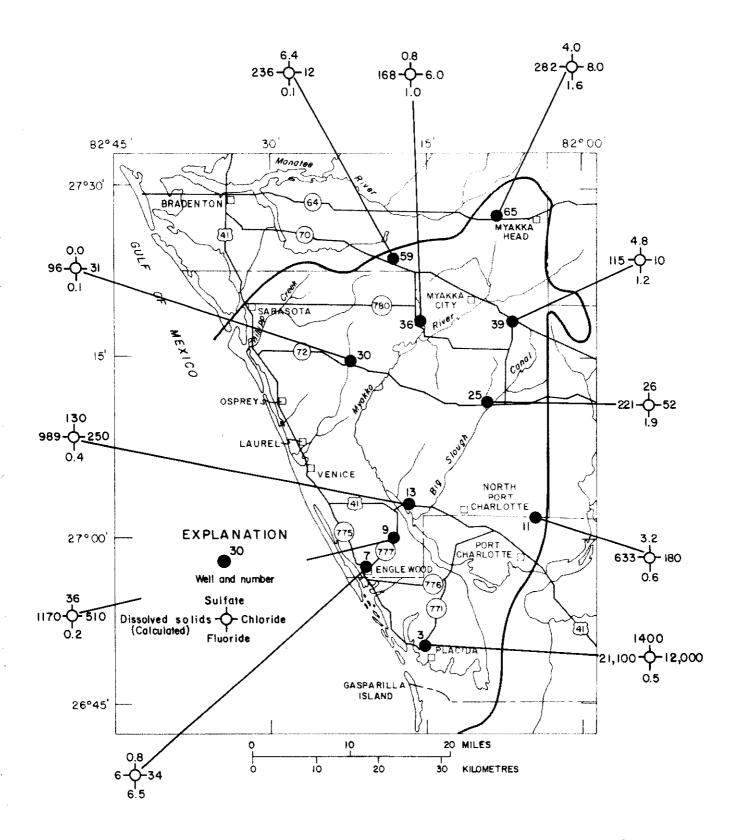


FIGURE 10. -- CHEMICAL QUALITY OF WATER FROM WELLS TAPPING ZONE-2

1.6 mg/l. High fluoride concentrations in water from wells in the southwestern part part of the area can be avoided by tapping only the shallower parts of the zone. For example, fluoride concentration in water from zone-2 from 37-125 ft (11-38 m) was less than 1 mg/l in test well 23 (fig. 6) near Osprey. Below 125 ft (38 m) the fluoride concentration was 2 mg/l, in well 23.

Sulfate concentrations were in excess of 250 mg/l in all water samples collected from test wells 31 and 35 (fig. 6) that tapped zone 2. Wells 3, 4, and 23 (fig. 6) also contain water with high concentration of sulfate at some depths. For example, at well 3 the sulfate concentration of water was 2,000 mg/l at 84-97 ft (26-30 m), but only 38 mg/l at 186-212 ft (57-65 m). Therefore, in these areas high sulfate concentrations can usually be avoided in wells tapping zone-2 by casing out those intervals (84-97 ft for well 3) that yield water with high shlfate.

Chloride concentrations in the water from zone-2 are less than 250 mg/l in the peninsula southwest of the Myakka River estuary.

Well 3 had the highest concentration recorded for the aquifer,

16,000 mg/l. This sample was obtained from within the aquifer interval 84 to 97 ft (26-30 m) below land surface. The concentration was substantially less but still high (2,700 mg/l) in a sample collected from a deeper interval, 136-184 ft (41-56 m), below land surface.

Although this chloride concentration greatly exceeds that recommended for public water supplies, it is well with the range for use by most desalinization processes.

Dissolved-solids concentration exceeded 2,000 mg/l in all samples taken from zone 2 in the peninsula southwest of the Myakka River estuary. A sample of water from well 3, collected from zone-2 within the interval 84-97 ft (26-30 m) contained 28,200 mg/l of dissolved solids. However, at 186 to 212 ft below land surface, water was found whose dissolved-solids concentration was only 4,500 mg/l which is suitable for desalting. Dissolved solids in water from the lower part of zone 2 in well 23 exceeded 1,000 mg/l.

Artesian zone-3

Zone-3 includes the permeable rock in the lower part of the Hawthorn Formation and the upper part of the Tampa Limestone (table 2). The zone consists of sand, sandy limestone, clay and hard limestone streaks that contain dark phosphatic pebbles throughout. This aquifer underlies the entire Myakka River basin area. The depth to the top of the aquifer increases from about 250 ft (76 m) below land surface in the northeast to about 450 ft (140 m) in the southwest.

Zone-3 is widely used as a source of irrigation water and yields as much as 500 gal/min (32 1/s) to individual wells. Test wells tapping this unit in the northeastern part of Sarasota County yielded 250 gal/min (16 1/s) with 90 ft (27 m) of drawdown. A few wells that tap both zone-2 and-3 produce 1,500 to 2,000 gal/min (95 to 126 1/s) with 90 ft (27 m) of drawdown.

Water Quality. -- The fluoride concentration in water from zone-3 in most of the area generally is high. For example, of the eight wells whose locations are shown on figure 11, all yielded water whose maximum fluoride concentrations, on the basis of recurrent sampling, were 1.7 mg/l or more. The minimum fluoride concentration was 1.0 mg/l or less for four of the eight wells. In general, water from zone-3 can be used for drinking by constructing wells that are open to both zones 2 and 3, thereby diluting zone-3 water with zone-2 water which is slightly less in fluoride concentration. The city of Sarasota uses water from zones 2 and 3 near Verna for their public supply. Fluoride concentration of mixed water is 1.5 mg/l; that obtained from zone-3 at Verna is 3.7 mg/l.

In general, where the fluoride, sulfate, and chloride concentrations in water from zone-3 meet drinking water standards, it is usable for public supply. Results of test drilling indicate that, in general, these standards are more readily met by water in the upper part of the zone than water from the lower part, particularly in the central segment of the Myakka River basin area.

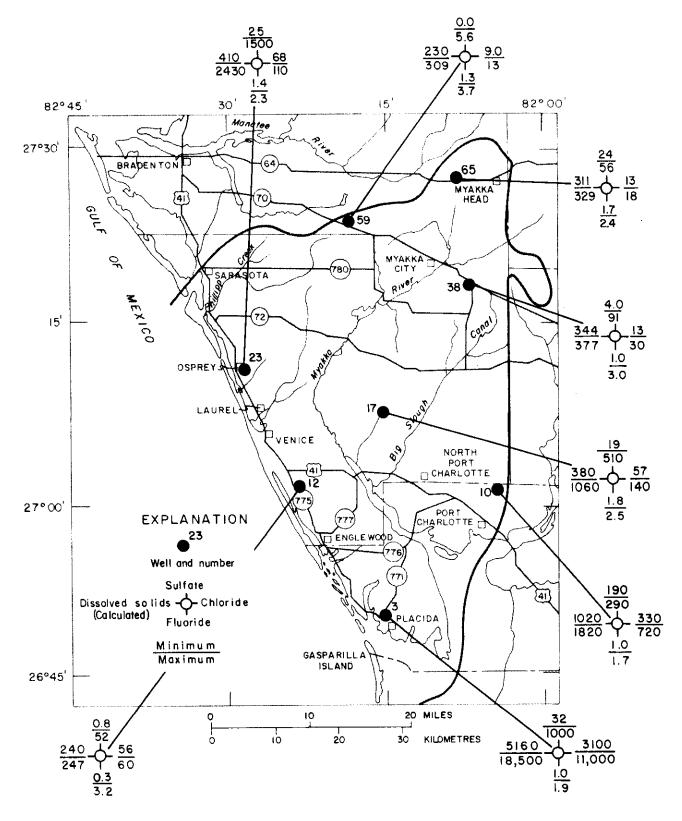


FIGURE 11. -- CHEMICAL QUALITY OF WATER FROM WELLS TAPPING ZONE-3.

Artesian zone-4

Zone-4 underlies all of the Myakka River basin area and consists of the lower part of the Tampa Limestone, all of the Suwannee Limestone and the upper part of the Ocala Limestone. The depth to this zone ranges from about 500 ft (150 m) in the northeast to about 700 ft (210 m) in the south and probably to greater depths in the southwest. The zone consists of two segments, an upper and lower, separated by a less permeable layer of limestone and white clay. Caliper logs of wells that penetrate this zone indicate that the upper segment is generally about 50 to 60 ft (15 to 18 m) thick and lies within 20 to 40 ft (6 to 12 m) of the top of the Suwannee Formation and that the lower segment is 30 to 50 ft (9 to 15 m) thick. The logs show that the less permeable layer is 30 ft (9 m) thick. Geophysical logs of wells indicate that in some parts of the area the two segments may be sufficiently interconnected vertically to form a single hydrologic unit.

Zone-4 is one of the most productive of the artesian zones, and most large diameter irrigation wells that tap it yield 500 to 1,500 gal/min (30 to 95 l/s). In the mid-1920's, many small diameter wells were drilled into the zone to provide water for truck farms. In the Sarasota area, these wells originally flowed as much as 450 gal/min (30 l/s). However, water levels in all wells that now tap the zone are below land surface, and wells require turbine pumps in order to obtain large yields.

Water levels in this zone fluctuate markedly in response to large seasonal withdrawals for crop irrigation. For example, the marked decline in 1967 (fig. 12) is the result of an unusually dry winter and spring during which time almost constant pumping was required for irrigation. With a return of wet weather in mid-May pumping ceased, and water levels recovered rapidly. During the next growing season, pumping again lowered levels substantially.

The hydrograph for observation well Sarasota 9 (well 41, fig. 12), a long-term observation well open to zones 2, 3, and 4, shows a net decline in water level during high water-level periods of about 2.5 ft (0.8 m) during 1960-67. The other wells shown on fig. 12 are open to zones indicated.

Water Quality.--In water from zone-4 in the central and coastal areas sulfate and fluoride concentrations generally are in excess of 250 and 1.5 mg/l, respectively. In the southwestern part of the area, well 5, 1,031 ft (314 m) deep and which is open to the depth interval 80 to 1,031 ft (73 to 314 m) yields water containing as much as 3,600 mg/l of chloride.

As with zones 1, 2, and 3, zone-4 yields water of better quality in the northeastern part of the area than elsewhere in the area. Of all the wells plotted, numbers 32, 38, 54, 55, and 65 tap zone-4 only. The others tap zones 2, 3, and 4.

Water in zone-4 in the extreme northeastern part of the area (well 65, fig. 13) meets EPA quality criteria for public supplies. Elsewhere in the northeastern part, sulfate and fluoride concentrations usually can be maintained below 250 mg/l and 1 mg/l, respectively, if wells are constructed so that water from zone-4 is diluted with water from zones 2 and 3.

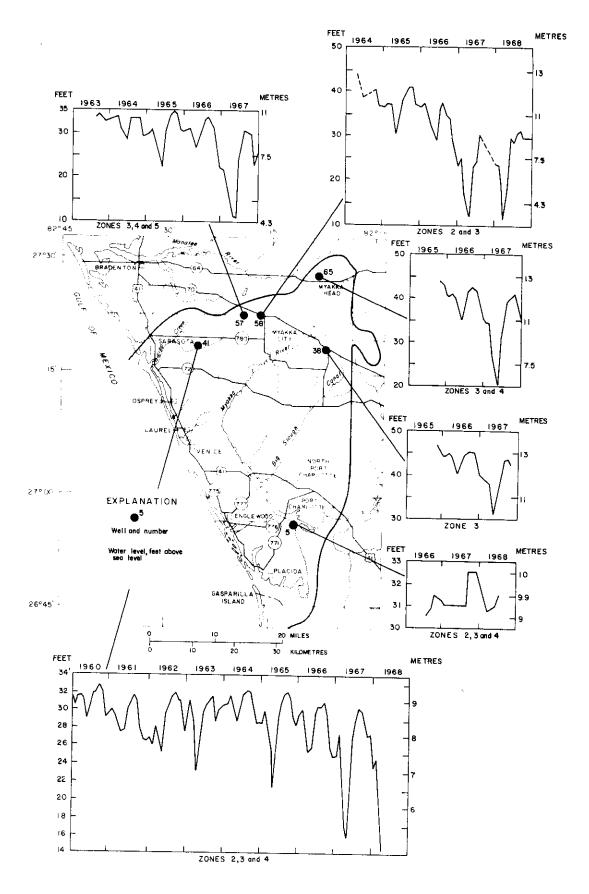


FIGURE 12.--HYDROGRAPHS OF SELECTED OBSERVATION WELLS TAPPING ZONES 2, 3, 4, AND 5.

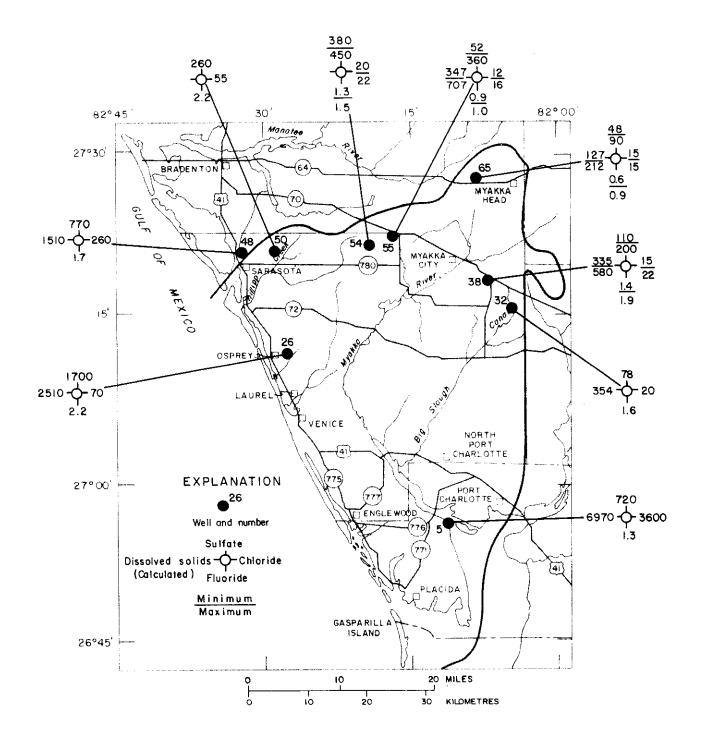


FIGURE 13.--CHEMICAL QUALITY OF WATER FROM ZONE-4 (WELLS 32, 38, 54, 55, AND 65) AND COMPOSITE CHEMICAL QUALITY OF WATER FROM ZONES 2, 3, AND 4 (WELLS 5, 26, 48, AND 50).

Water levels in this zone fluctuate markedly in response to large seasonal withdrawals for crop irrigation. For example, the marked decline in 1967 (fig. 12) is the result of an unusually dry winter and spring during which almost constant pumping was required for irrigation. With a return of wet weather in mid-May pumping ceased, and water levels recovered rapidly. During the next growing season, pumping again lowered levels substantially.

The hydrograph for observation well Sarasota 9 (well 41, fig. 12), a long-term observation well open to zones 2, 3, and 4, show a net decline in water level during high water-level periods of about 2.5 ft (0.8 m) during 1960-67. The other wells shown on fig.12 are open to zones indicated.

Water Quality. -- In water from zone-4 in the central and coastal areas sulfate and fluoride concentrations generally are in excess of 250 and 1.5 mg/l, respectively. In the southwestern part of the area, well 5, 1,031 ft (314 m) deep and which is open to the depth interval 80 to 1,031 ft (73 to 314 m) yields water containing as much as 3,600 mg/l of chloride.

As with zones-1-3, zone-4 (fig. 13) yields water of better quality in the northeastern part of the area than elsewhere in the area. Of all the wells plotted, numbers 32, 38, 54, 55, and 65 tap zone-4 only. The others tap zones 2, 3, and 4.

Water in zone-4 in the extreme northeastern part of the area (well 65, fig. 10) meets EPA criteria for public supplies. Elsewhere in the northeastern part, sulfate and fluoride concentrations usually can be maintained below 250 mg/l and l mg/l, respectively, if wells are constructed so that water from zone-4 is diluted with water from zones 2 and 3.

On the basis of water-quality data from wells 5, 26, and 48 in the southwestern one-third of the area, the water from zone-4 is unsuitable for any purpose except perhaps limited irrigation, cooling, or sanitary use. In the peninsula, no wells produce from this zone because of the poor water quality.

Most of the older supply wells of the city of Sarasota tap zones 2, 3, and 4. The analysis of water from well 48 (fig. 13 and table 4), is typical of the old supply wells and exceeds EPA criteria in dissolved solids, fluoride, sulfate, and chloride for public water supply.

Zone-5

Zone-5 consists of the permeable rock in the Avon Park Limestone-"the big water," as many drillers call it. None of the U.S. Geological
Survey test wells drilled in the Myakka River basin penetrate this zone.
It is the major water-producing unit of the artesian Floridan aquifer
throughout southwestern Florida. Zone-5 underlies the entire Myakka River basin area at depths ranging from about 1,000 ft (305 m) below land
surface in the north and east to more than 1,500 ft (460 m) below land
surface in the south and southwest. This zone is separated from the over
lying zones by the lower part of the Ocala Limestone, which is 300 to 400
ft (100 to 120 m) thick and which forms a confining layer of low vertical
permeability. Because of the depth to this zone, it is tapped only when
large amounts of water are required.

Table 4.--Analysis of water obtained from well 48 that taps Zones 2, 3, and 4
(Analysis by U.S. Geological Survey; in milligrams per litre except specific conductance, pH, and color. Depth of well, 675 feet; length of casing, 80 feet; location shown on fig. 10).

Silica (SiO ₂)	27	Nitrate (NO ₃)	.00	
Iron (Fe)	.00	Phosphate (PO ₄)	.00	
Calcium (Ca)	230	Dissolved solids		
Magnesium (Mg)	100	Calculated	1,510	
Sodium (Na)	100	Residue	1,860	
Potassium (K)	6.6	Hardness	990	
Bicarbonate (HCO3)	160	Specific conductance, micro	2,000	
Sulfate (SO ₄)	770	mhos/cm at 25°C		
Chloride (C1)	260	рН	7.4	
Fluoride (F)	1.7	Color	2	

Zone-5 is developed in combination with other zones as a source of water for irrigation wells that yield as much as 1,500 to 2,000 gal/min (95 to 125 1/s) each. Use of water from the zone follows a pattern that is repeated each year and results in heavy pumping during the spring tomato and melon growing season, which runs from mid-February through mid-May followed by very little pumping from June to September. The amount pumped from zone 5 increases each year. Most of the irrigation withdrawal is confined to the northeastern part of the basin. Each year, growers clear part of the range to grow melons. As payment for land use, the grower ditches and grades the land, and drills an irrigation well, which is usually 12 in (305 mm) in diameter and has a pumping capacity of 2,000 gal/min (125 1/s). During the growing season (about 3 months) the well is pumped continuously. As soon as the crop is harvested, the land and the well revert to the cattle-ranch owner, who then installs a permanent pump that is used to irrigate grass on the abandoned melon fields.

For economic reasons, wells are usually cased only to the first hard-rock unit, usually less than 200 feet (60 m) and the rest of the hole is open to several aquifer zones. After initial use for melon irrigation the wells may stand idle for months or even years before being pumped again. During this time, uncontrolled mixing of water of different quality occurs in the wells. Water moves in the wells from zones with higher head into zones with lower head. For example, water may move from zone-5, up the well bore, into zone-4, which has a lower head. Such mixing can cause the quality of water in the upper zone to deteriorate.

Water quality--Water in zone 5 is more highly mineralized than that in zones 1-4. Except for the extreme northeastern part of the area, the sulfate and generally the fluoride concentrations exceed the water-quality criteria of EPA for public supply (fig. 14 and page 28). In the southern part of the Myakka River basin area the chloride concentration in water from zone 5 also exceeds the limit. (See well 5, fig. 14.) Several attempts were made to use water from zone 5 along the northern part of the study area for municipal water supply, but its mineral concentration was too high for such use.

Water with less than 300 mg/l of dissolved solids is available in zone 5 in the extreme northeastern part of the Myakka River basin area. Well 67 yields water of excellent quality as shown in figure 14. Between this well and Myakka City, water from zone 5 is of acceptable quality for public supplies except for the fluoride concentration, which in places is as much as 2.0 mg/l. In water from zone 5 in the east-central part of the area sulfate and fluoride concentrations are as much as 390 and 1.8 mg/l.

In 1957 the city of Sarasota attempted to develop zone 5 to furnish water for a swimming pool, but found that at a depth of 1,240 feet (378 m) the water was too saline for use. In 1962, the city of Sarasota again attempted to develop a water supply from this zone by drilling to 1,232 feet (376 m). However, at that depth the well yielded water whose dissolved solids concentration was more than 3,100 mg/1. When plugged back to about 1,000 ft (305 m), this well yielded water of acceptable quality from zone-4, for use as an irrigation well on a golf course.

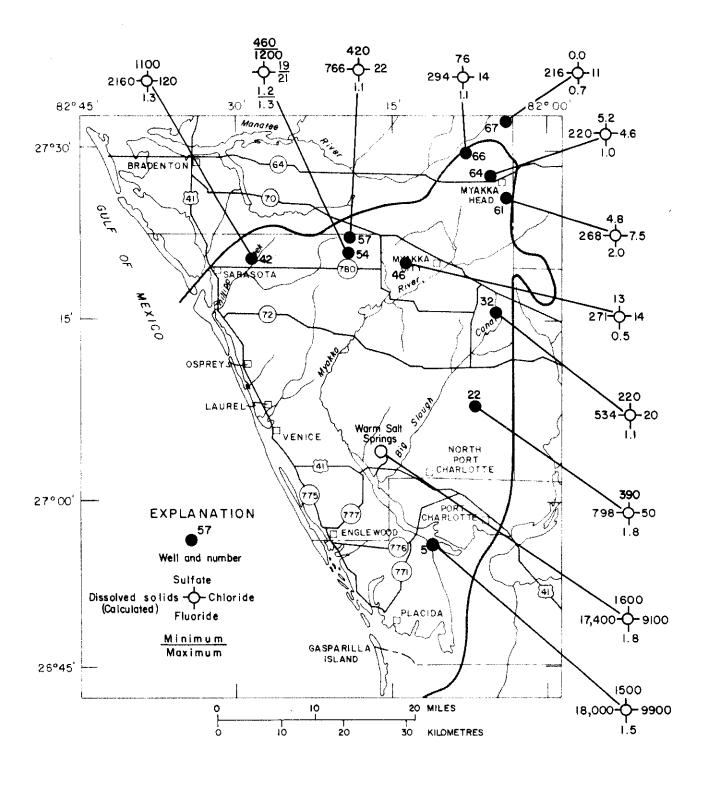


FIGURE 14.--COMPOSITE CHEMICAL QUALITY OF WATER FROM ZONES 2, 3, 4, AND 5, AND WARM SALT SPRINGS.

Well 54, city of Sarasota test well KME 1, at a depth of 1,462 ft (446 m) yielded water from zone-5 with a minimum chloride concentration of only 19 mg/l. Its sulfate concentration, however, was over 450 mg/l. When the well was deepened to 1,493 ft (455 m) and was open to the interval 1,462-1,493 ft (446-455 m) it yielded water containing only 21 mg/l of chloride but sulfate concentration increased nearly three-fold, to 1,200 mg/l.

Water from Warm Salt Springs probably originates in part from zone-5; the water temperature (30°C) and the quality characteristics of the water (fig. 14) are similar to water from well 5. Table 5 shows analyses of water from the springs and well 5, which is near the mouth of the Myakka River. Similarities of the major constituents in water from both sources indicate that the water is originating from either zone-5 or from zones 2-5.

TABLE 5.--Analyses of water from Warm Salt Springs and well 5.

(Analyses by U.S. Geological Survey; in milligrams per litre except specific conductance, pH, and color.)

	Warm Salt Springs	Cattle Dock Point, well 5
Silica (SiO ₂)	17	7.9
Iron (Fe)	.00	.00
Calcium (Ca)	500	460
Magnesium (Mg)	570	670
Sodium (Na)	5,400	5,200
Potassium (K)	180	190
Bicarbonate (HCO3)	160	130
Sulfate (SO ₄)	1,600	1,500
Chloride (C1)	9,100	9,900
Fluoride (F)	1.8	1.5
Nitrate (NO ₃)	15	7.5
Dissolved Solids (calc.)	17.400	18,000
Hardness (as Ca CO ₃)	3,600	3,900
Specific conductance micro- mhos/cm at 25°C	26,600	28,600
рН	7.3	7.0
Color (pt-Co units)	5	5

Potentiometric surface

The configuration of the potentiometric surface of the artesian zones 2-5 at the end of a dry and a wet period is shown on figures 15 and 16, respectively. Most of the wells used in preparing these maps were open to zones 2-4, and a few to zones 2-5. The water level in each well represents the composite head in the zones penetrated by the well. The maps show that the regional gradient and principal direction of flow is from east to west. The potentiometric surface was higher in November 1966 than in June 1966: recharge from heavy summer rains and cessation of pumping for irrigation during the rainy season cause water levels to rise. Where heavy pumping markedly lowered the potentiometric surface (fig. 15) troughs in the surface were created.

In much of the area water levels in wells that tap zones 3-5 rise above land surface and at the end of the rainy season wells will flow. This is the area of artesian flow of figure 16. Many flowing wells were observed during the investigation.

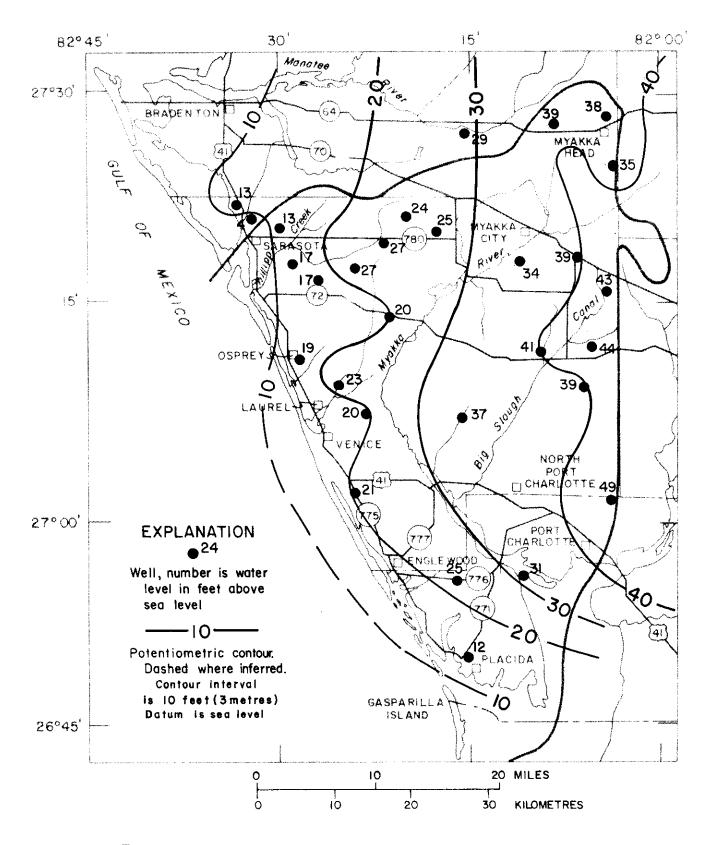


FIGURE 15.--GENERALIZED CONFIGURATION OF COMPOSITE POTENTIO-METRIC SURFACE OF ZONES 2, 3, 4, AND 5 IN JUNE 1966

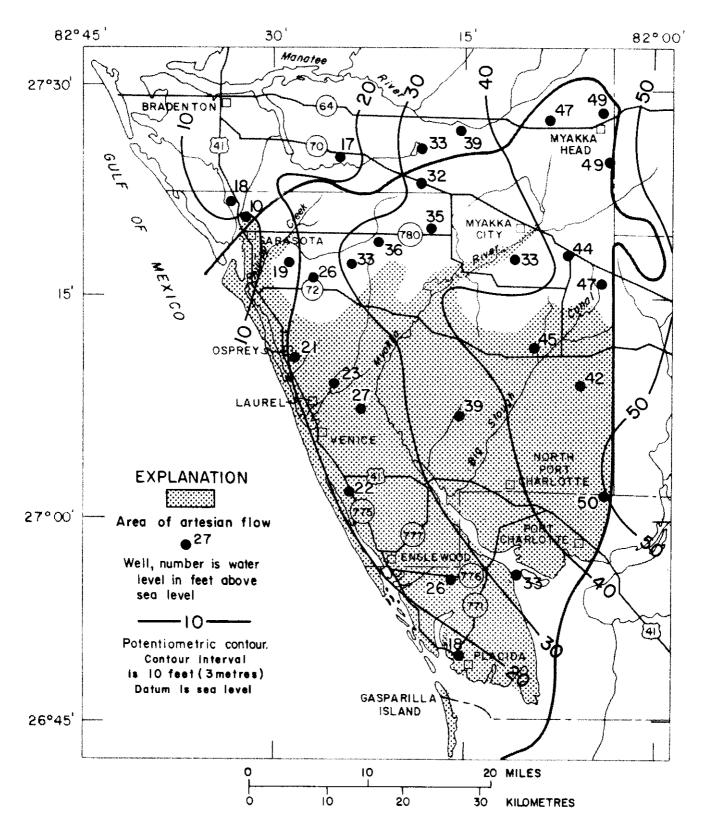


FIGURE 16.--GENERALIZED CONFIGURATION OF COMPOSITE POTENTIO-METRIC SURFACE OF ZONES 2, 3, 4, AND 5 IN NOVEMBER 1966 AND AREA OF ARTESIAN FLOW.

Surface Water

Streamflow

Most of the streams in the Myakka River basin area have small drainage basins, are of short channel length, and do not yield high volumes of flow. The yields of many, however, are sufficient that they represent a potential source of fresh water to supplement the water-supply needs of the urbanizing coastal zone. The scarcity of sites suitable for impoundments along most streams will severely limit the development of streamflow as an adjunct to the ground-water supply--to-satisfy water demand during droughts.

Flippo and Joyner (1968) discuss low-flow characteristics of streams in the Myakka River basin area such as frequency and magnitude flow duration, and water quality, and they analyze the draft-storage relations of Upper and Lower Myakka Lakes. The text that follows, including the section on water quality, is a summary of their findings.

Streamflow data, collected since 1936 in the area, indicate that all non-tidal reaches of streams ceased natural flows during at least five droughts since 1938. Many of these non-tidal reaches go virtually dry late in the spring during most years. Upper and Lower Myakka Lakes, through which the Myakka River flows, occupy two of the largest natural depressions in the area and their aggregate storage capacity at 16 ft (5 m) and 14 ft (4 m) above sea level is approximately 8,100 acre-ft (3300 ha^2) . The average discharge at a stream gaging station located between the two lakes is 266 ft³/s $(7.5 \text{ m}^3/\text{s})$ or about 193,000 acre-ft

 $(78,000 \text{ ha}^2)$. Draft-storage studies indicate that the Upper and Lower Myakka Lakes--if maintained at 14 and 10 ft (4 and 3 m) above ms1, respectively--could provide a continuous draft of 6.5 Mga1/d (0.28 m³/s) over a 30-year drought and 10 Mga1/d (144 m³/s) over a 20-year drought.

A feasibility study of the lower Myakka River would allow exploring the possibility of impounding this stream as a supply for the southeastern part of the area. Large quantities of water are stored in the channel of the lower Myakka River. A low-head dam would keep saltwater out of the stream and retain the freshwater for use during droughts.

Water Quality

During the dry season, streamflow is maintained by ground-water discharge, and, as a result, chloride, sulfate, and dissolved solids concentrations and the hardness of the water are above drinking water standards for some streams. During the wet season, streamflow is mainly from overland runoff, and the concentrations of these constituents and the hardness of the water are minimum. The range in concentrations of constituents or in characteristics is shown in table 6 for water from 23 surfacewater sampling sites. The location of these sites is shown on figure 17. During the wet season, water from swamps and marshes flows into the streams, and the color of the water is then maximum. Flow from swamps and marshes diminished or ceases during the dry season, at which time the color of the stream is least.

During the dry season most of the streams contain water whose hardness is more than 180 mg/1; during the rest of the year the hardness is less than 180 mg/1 for most of the streams. The hardness of water in streams in the coastal areas generally is greater than in those inland. The upper reaches of the Myakka River contain the softest water in the area.

The chloride, sulfate, and dissolved-solids concentrations of water from most of the streams sampled during the study generally are less than 250, 250, and 500 mg/l. In the coastal area the chloride concentration of all tidal-affected streams generally is more than 250 mg/l. Barriers in Phillipi Creek and Big Slough prevent upstream movement of saltwater.

TABLE 6. - Range in quality of surface water in Myakka River basin area. (Results in milligrams per litre except specific conductance, color and temperature).

Number (fig. 14)	Sampling Sites Name	Period of Record (years)	Number of Analyses	Chloride (C1)	Sulfate (SO ₄)	Dissolved Solids (Sum of constituents)	Hardness as CaCO ₃	Specific Conductance (Micromhos/cm at 25°C)	Color (Pt-Co units)	Temperature
1	Niagara Water at Port Charlotte	62-66	8	18 - 54	4.4- 11	67- 222	37~ 150	125- 389	90~240	12-29
2	Fordham Water at Port Chalotte	62-66	8	32 - 130	9.6- 37	187- 420	120- 250	328- 770	45- 80	13-30
3	Morningstar Water ar Port Charlotte	63-66	7	30 -1,200	16 -230	295-2,550	220- 700	500- 4,240	20- 40	12-31
4	Myakka River near Myakka City	63-65	6	9.0- 16	0.8- 9.0	32- 55	16- 34	50- 130	100-250	19-26
5	Wingate Creek near Myakka City	63-65	3	8.0- 13	3.6- 16	42- 78	21- 54	72- 140	20- 80	19-24
6	Myakka River at Myakka City	62-66	14	3.0- 24	0.0- 8.6	18- 67	10- 38	35- 142	60-210	9-27
7	Myakka River near Sarasota	62-66	(a)	5.0- 30	1.6- 25	26 57	11- 72	35- 249	80-280	6-34
8	Myakka River at Rocky Ford near Venice	62-65	7	12 - 37	16 -260	77- 578	50- 440	150- 860	35-100	17-33
₹ 9	Myakka River near Venice	63-66	12	12 -2,300	8.4-450	48-4,600	28-1,000	b91- 5,200	30-170	6-28
10	Deer Prarie Creek near Venice	62-65	6	17 – 24	6.4- 7.6	161- 215	120- 180	260- 870	10- 60	17-28
11	Big Slough Canal near Myakka City	62-66	13	8.2- 54	5,2-250	49- 576	30~ 440	80- 905	35-360	16-32
12	Big Slough near Murdock	62-66	12	24 - 120	18 -230	115- 552	72- 390	188- 975	2-120	17-32
13	East Branch Coral Creek near Placida	66	1	550	44	1140	390	2,275	100	-
14	Oyster Creek near Englewood	62-66	5	3600 -5,100	480 -860	6,620-8,950	1,900-2,600	8,000-15,000	30- 50	17-27
15	Alligator Creek near Venice	62-65	4	120 - 289	130 -410	595-1,180	400- 720	830- 1,780	45- 85	22-31
16	Cow Pen Slough near Bee Ridge	62-66	15	11 - 70	15 -370	54- 638	29- 470	101- 1,350	15-170	9-34
17	Cow Pen Slough near Laurel	62-65	4	41 - 60	100 -180	448- 549	330- 420	610- 812	20- 50	21-26
18	South Creek near Osprey	62-65	5	34 - 360	20 -280	362-1,020	290~ 570	600- 1,760	20- 70	19-27
19	Phillipi Creek near Sarasota	63-66	(a)	10 - 60	50 -450	130- 873	86- 620	210- 1,660	0-140	10-34
20	Main B Canal at Sarasota	62-66	13	20 - 63	14 -120	92- 418	62- 160	142- 655	20-150	14-29
21	Phillipi Creek at Sarastoa	62-66	9	31 - 56	72 -240	364~ 559	190- 410	490- 840	30- 60	18-27
22	Walker Creek at Sarasota	62-66	6	22 ~ 200	71 -540	285-1,270	200- 820	430- 1,700	20- 55	19-27
23	Manatee River near Bradenton	62-66	(a)	2.0 13	0.0- 12	22- 80	6- 140	19- 263	5-220	9-32

a DS-Daily Station. Daily specific conductance and temperature. Approximately 3 composites per month for analyses.

b Peak during period October 1965 to September 1966 was 7,500.

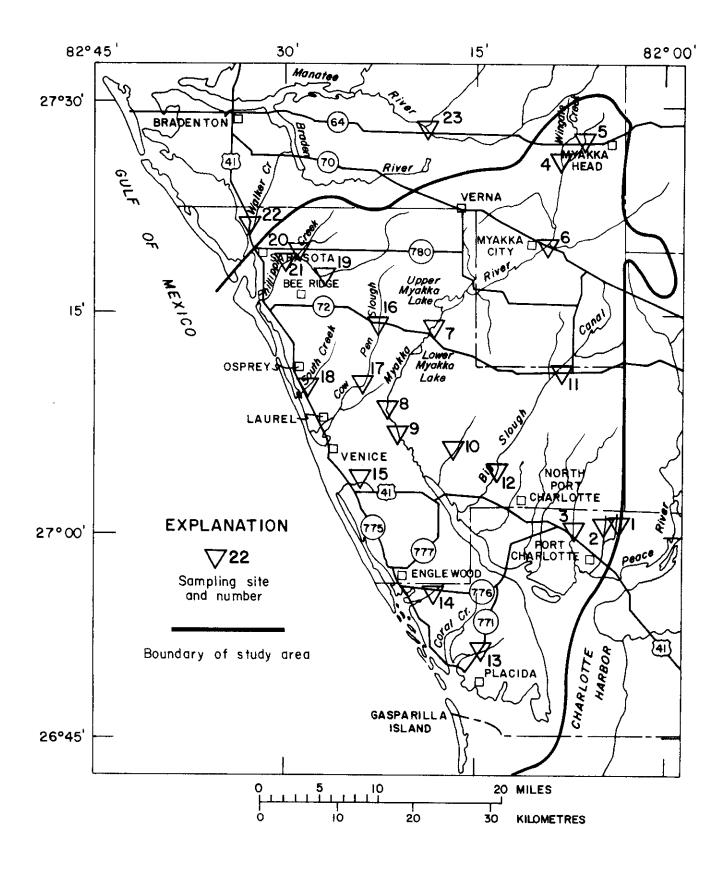


FIGURE 17.--surface-water sampling sites.

Lakes

The principal two lakes in the Myakka River basin area are the Upper and Lower Myakka Lakes. Both occupy shallow depressions; the shallowest parts contain a heavy growth of aquatic vegetation. On lake bottoms in the deeper parts of the lakes are soft layers of decaying organic material. The lake bottoms around the edges and at the inlets are firmly packed sand.

The two lakes have been considered from time to time for use as a public water supply. Bt maintaining a level of 14 ft (4 m) above mean sea level at the upper lake and 10 ft (3 m) at the lower lake, about 4,600 acre-ft (1,860 ha²) of water could be stored. The area also contains hundreds of small lakes and ponds that have a surface area less than 200 acres (80 ha) each. Most of these are in the western half of the area. They are shallow and may go dry during moderate droughts. Levels of some, of the larger lakes in urbanized areas are maintained by pumped ground water during extended dry periods.

Springs

Few springs are in the Myakka River basin area. Nearly all issue from solution cavities that are open to zones of artesian flow.

Warm Mineral Springs (Warm Salt Springs) is in Sarasota County, 5 mi (8 km) northwest of North Port Charlotte (fig. 14). The spring head is a pool about 250 ft (75 m) in diameter and 167 ft (57 m) deep (Ferguson and others, 1947, p. 148). The spring discharges to Salt Creek, a tributary of the Myakka River, at a rate of about 10 ft 3/s (0.3 m 3/s). The water temperature varies little from 86°F (30°C) and the chloride concentration is about 9,300 mg/l. The spring is used for mineral baths.

Little Salt Spring is 2.0 mi (3.2 km) northeast of Warm Mineral Springs. The spring flows into a circular pool about 250 ft (75 m) in diameter. Spring discharge measured between April 1946 and June 1962, ranged from 0.89 to 1.53 ft³/s (0.03 to 0.04 m³/s). The flow has been reported as low as 0.17 ft³/s (0.005 m³/s) (Ferguson and others, 1947, p. 146). Temperature of the water has ranged from 71.6° to 91.4°F (22° to 33°C). The chloride concentration of the spring water is about 1,300 mg/l, and the dissolved-solids concentration is about 3,000 mg/l.

Pinehurst Spring is on the bank of a small bayou on Little
Sarasota Bay about 7.0 mi south of Sarasota. A flow of 0.006 ft³/s
(0.0003 m³/s) was measured on April 30, 1946, and a flow of as much
as 0.11 ft³/s (0.003 m³/s) has been reported (Ferguson and others,
1947, p. 147). In recent years, discharge has decreased as water
levels in the artesian aquifers tapped by the spring have declined.
The quality of water from the spring has gradually deteriorated with
the lowering of water levels. The chloride and sulfate concentrations
of the spring water were reported to be 34 and 9.4 mg/l in 1943.
On June 15, 1962, the chloride and sulfate concentrations of the
water were 106 and 39 mg/l.

A seepage zone or spring line occurs along the Myakka River valley about 2.0 mi (3.2 km) southwest of Myakka City. The seeps issue from the top of a hardpan in the water-table aquifer that crops out in the valley wall. At least one of these seeps may be perennial. The flow of each individual seep is probably less than 0.004 ${\rm ft}^3/{\rm s}$ (0.0001 ${\rm m}^3/{\rm s}$)

A deep hole, nearly circular, occurs in the bed of the Myakka River about 150 ft (46 m) to the right from midstream near the outlet to Lower Myakka Lake. On July 15, 1965, the hole was about 300 ft (90 m) in diameter at the top and 124 ft (38 m) deep. The nearly vertical walls of this opening angle slightly northward from top to bottom and the hole is 40 to 50 ft (12 to 15 m) in diameter for most of its depth. The flow issuing from the hole probably ceases when the stage of the Myakka River is exceptionally high and during extended low-flow periods. At times the flow may be as much as 1.5 $\rm ft^3/s$ (0.04 m $^3/s$).

WATER USE

About 16.5 billion gallons (62.5 million cubic metres) of ground water were withdrawn in the Myakka River basin area in 1965. This withdrawal is equivalent to an average pumpage of about 45 Mgal/d (2 m³/s). Because of the seasonal pattern of water use, probably 40 percent of the annual total use occurs during the dry spring. More water is used for irrigation than for all other uses combined. Of the irrigation use, the largest single use is for pasture irrigation. Public supply is about 35 percent of total use and industrial commercial use is less than 1 percent (table 7).

In 1965, 23 major public-supply systems used ground water as a source in the Myakka River basin area; all of these were in Sarasota County. The area also has many small systems which serve less than 100 units, such as trailer parks and motels. The quantities of water used by these systems are included in the estimate of use for public supply. Sarasota and Venice, the two principal public-supply systems, withdrew about 1.4 and 0.2 billion gallons (5.3 and 1.1 million cubic metres), respectively during 1965 (fig. 15). Of the 120,000 persons living in the area in 1965 about 75,000 were served by private wells. On the basis of an estimated per capita use of 120 gallons (450 litres) per day, the daily rural domestic use was 9 Mgal/d (0.4 m³/s).

Table 7.--Estimated ground-water pumpage in the Myakka River basin area in 1965.

		Duration of Pumping (days)	Pumping rate (million gallons per day)	Amount pumped (billion gallons per year)
Public-water supply Industrial-Commercial ^a		365	6.8	2.5
		365	0.4	.1
Ru	ral Domestic	365	9.0	3.3
	Citrus	50	19	1.0
	Vine crops		·	
	Spring	90	20	1.8
	Fall	90	2.9	.3
	Spring Fall Row crops			
Irrigation	(Spring and fall)	120	4,3	.5
rrig	Improved Pasture	40	95	3.8
H	Golf courses (8 in area)	300	5	1.5
	Lawns	120	14	1.7
Total				16.5
	ighted average daily pumpage		45	

 $[\]underline{\underline{a}}/$ Principally used for cooling air-conditioner condensers.

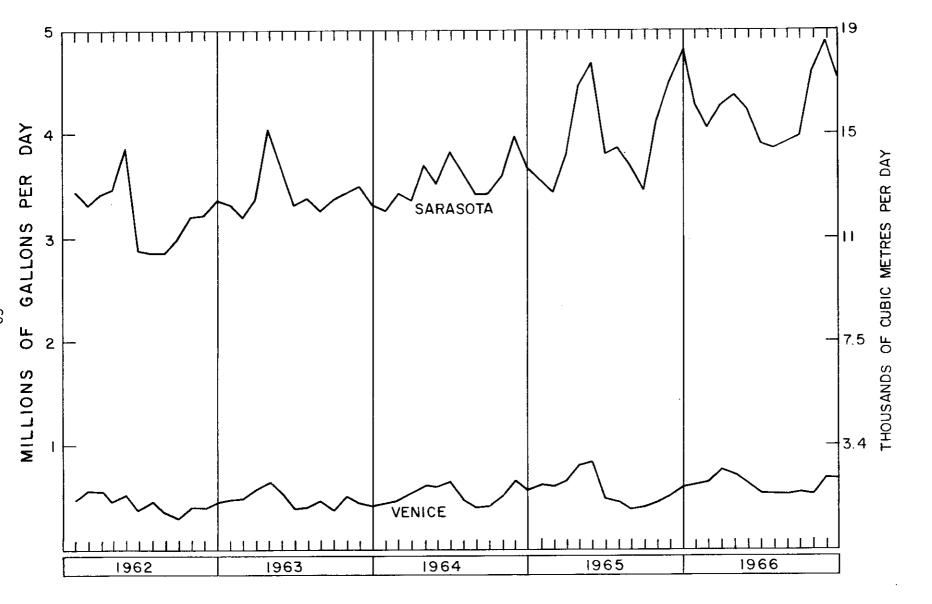


FIGURE 18.--PUMPAGE FOR THE CITIES OF SARASOTA AND VENICE, 1962-66.

The amount of ground water used for irrigation was grouped into 5 categories: citrus, truck farming, improved pasture, golf courses, and lawn watering. In 1965, about 4,000 acres (1600 ha) of citrus were irrigated. Of this amount, half was in Sarasota County and half in Manatee County. The rate of application for citrus was estimated to be 5,000 gal/min (315 1/s) per 8-hr day for 500 acres (200 ha) during the irrigation season.

Truck farmers in the area plant a spring and fall vine crop. The 1965 spring vine crop was about 3,500 acres (1400 ha) of tomatoes, melons, squash, and cucumbers. These crops were irrigated continuously 24 hours a day for approximately 90 days at the rate of about 2,000 gal/min (126 1/s) or 2.9 Mgal/d per 500 acres (200 ha). The 1965 fall vine crop consisted of about 500 acres (200 ha) of tomatoes irrigated at the same rate for the same duration. Row crops are planted on muckland in September, and final harvesting is in mid-May. These crops are irrigated only occasionally during the drier part of the season.

The same amount of water is used for irrigation of improved pasture as for vine-crop irrigation: 2,000 gal/min (126 1/s) or 2.9 Mgal/d per 500 acres (200 ha). The pasture irrigation season lasts about 40 days each year. Within the study area in 1965, about 12,500 acres (5100 ha) of improved pasture in Manatee County and 4,000 acres (1,600 ha) in Sarasota County were irrigated.

Golf courses use large amounts of water for irrigation of fairways and greens. Within the study area, Sarasota County has seven courses and Charlotte County one. An irrigated 18-hole golf course requires about 400 gal/min (25 1/s) or 0.6 Mgal/d for 300 days each year, the daily golf-course use in the area for those 300 days is 5 Mgal/d (0.2 m^3/s).

Many home owners have individual wells to supply water for lawn irrigation and automatic sprinkler systems. The following data were used to estimate the water use for this purpose:

Total population	120,000			
3 persons per dwelling	40,000 dwellings			
1/5 acre per dwelling lot	8,000 acres (3200 ha) occupiéd			
50 percent of acreage consist of lawn	4,000 acres (1600 ha) of lawn			
60 percent of homeowners irrigate	2,400 acres (970 ha) irrigated			
remove large to the energy periods toucketter shout 130 target				

On the average, lawns in the area require irrigation about 120 days per year. The application rate is about 50 gal/min (3.2 1/s) per acre applied 2 hours per day, or about 0.006 Mgal/d per acre.

In 1965 only about 2.5 Mgal/d $(0.1 \text{ m}^3/\text{s})$ of surface water was used for public water supply and pasture irrigation.

WATER PROBLEMS

The water problems in the Myakka River basin area are varied, complex, and often interrelated. They include flooding, inadequate or excessive drainage, inadequate supply of water of suitable quality, and deterioration of the supply by pollution and saltwater encroachment. Some problems are the result of man's alteration and stressing of the environment and his need for large quantities of water of good quality. Where serious conflicts in consumptive use of a limited supply are anticipated, priorities of use should eventually be established. This would involve legal, economic, and sociological as well as hydrologic considerations.

Floods

Much of the Myakka River basin area is subject to flooding when rainfall is exceptionally heavy. Ditching has accelerated drainage from many parts of the area that would experience temporary flooding during periods of normal rainfall. The urbanizing coastal area also is subject to flooding when tides are abnormally high. The problems associated with flooding and the delineation of flood-prone areas are beyond the scope of this study. Estimates of the magnitude and relative occurrence of flood discharges can be obtained from a regional flood study by Barnes and Golden (1966).

When rainfall is heavy, the capacity of some natural channels and canals is inadequate for rapid conveyance of flood waters, thereby resulting in widespread flooding of lowlands. These flood-prone areas may be inundated for as long as 1 month. About one-third of the land below an altitude of 40 ft (12 m) is subject to this type of flooding. The coastal areas below 10 ft (3 m) are also vulnerable to flooding caused by exceptionally high tides generally above 5 feet. Tidal studies made by the U. S. Army Corps of Engineers (1961) indicate that a tide of 10 to 12 ft (3 to 3.7 m) may be expected on the average about once every 100 years.

Urban development along these low-lying coastal areas has expanded rapidly since 1950. At the present stage (1965) of urban development and flood protection, storms of the magnitude of those in 1960 and 1962 are likely to cause major flood damage.

With the expansion of agriculture into low-lying areas, annual flood damages have steadily increased. Although drainage of agricultural lands has reduced the incidence of minor flooding, it has also encouraged greater expansion of agriculture onto the flood plains. As a result, by 1960 the estimated average annual flood damage to agriculture in the Phillippi Creek and Cow Pen Slough basins had increased to more than \$100,000 (U. S. Soil Conservation Service, 1961).

Drainage

Closely allied to flood problems are those resulting from drainage of the land. Lowlands have been drained to make them available for farming. Also water levels in the water-table aquifer have been lowered to make lowlands habitable, and drainage divides have been crossed by ditches in efforts to improve drainage. As a result, water moves more readily from land to the sea; consequently recharge to the aquifers is reduced.

Supply

One of the most pressing problems in the Myakka River basin area is the need for additional public-water supply of suitable quality to meet the requirements of a growing population. In addition, irrigation requirements are also increasing. Suitable sites are generally not available for the development of surface-water supplies, and ground water of suitable quality is restricted to specific aquifer zones in certain areas. Thus, the competition for water that meets drinking-water standards is keen. To some extent this problem can be alleviated in topographically suitable areas where some creeks can be impounded to maintain water levels in shallow aquifers developed for public supplies. For example, the impoundment on Coral Creek (fig. 17) about 1 mile from a well field, maintains high water levels in the well field and curtails saltwater intrusion in the immediate area. Oyster Creek and Gottfried Creek near Englewood may be suitable for similar types of water-supply development and control. Sampling site 14 (fig. 17) is on Oyster Creek; Gottfried Creek is about 1 mile north.

Contamination

Freshwater supplies in the Myakka River basin area are subject to contamination as a result of intrusion of saltwater mixing of ground water of poorer quality with that of better quality by interaquifer flow, and pollution of streams and aquifers by man-made wastes. No widespread intrusion of saltwater due to overpumping of the freshwater aquifer is known in the coastal area. Nonetheless, the potential exists for intrusion as a result of increased use of the freshwater resources, particularly in the coastal areas where use of wells for lawn irrigation is increasing. In addition, construction of saltwater canals inland where none previously existed has resulted in intrusion of saltwater into the aquifers in the Venice area.

The hydraulic placement on upland areas of material removed during construction of saltwater canals has resulted in saltwater contamination of aquifers. Leachate and drainage from these spoil piles has infiltrated into the water table and artesian aquifers and locally replaced the freshwater contained in them.

Washover of saline water from the Gulf during storms or high tides has, on occasion, contaminated potable supplies in the water-table aquifer in some of the southern keys. Considerable time likely will be required for natural flushing action to return the ground water to usable quality.

In some areas saltwater does occur in the aquifer zones that elsewhere contain freshwater. The quality characteristics of Warm Mineral Springs and Little Salt Springs suggest that this water results from upward migration of highly mineralized water from deep aquifer zones, perhaps along fracture systems in the rocks. This water may contaminate shallow aquifers near these springs.

The possibility of direct saltwater intrusion from the Gulf into the freshwater aquifers exists on the Keys where wells no longer used have not been plugged. Erosion has removed the previously habitable land and the wells are exposed to salt water. If the artesian head in the aquifers is reduced sufficiently to allow water from the Gulf to move down these wells, direct contamination will result.

Intermixing of water of differing qualities between aquifer zones also occurs in wells when the casing is driven only to the uppermost hard-rock stratum. When the well is not in use, water from a permeable zone with a higher head can migrate into a permeable zone with lower head (Joyner and Sutcliffe, 1967). Thus a well bore can serve as a conduit allowing water of poor quality to intrude a zone containing water of good quality. The enactment of the Sarasota and Manatee County well-drilling codes in 1963 has changed the procedure for drilling wells. Casing installation procedures now require the isolation of zones which contain water of undesirable chemical quality. New procedures have been developed for the drilling of wells in areas where saltwater overlies the freshwater zones (Joyner and Sutcliffe, 1967); this situation is found commonly on the Keys and where salt and other undesirable contaminants are present in the overlying strata. Plugging of unused wells is now required when a replacement well is to be drilled.

Pollution from a variety of sources has deteriorated water quality in some streams and aquifers in the area. For example, effluent from waste-treatment plants is discharged into canals and eventually reaches coastal bays and estuaries. As a result, large offshore areas have been closed to shellfish harvesting. Pollution can be anticipated in the runoff from farmed areas where agricultural chemicals are heavily applied. The residues from these chemicals may be carried by sediment transported in the streams. If new phosphate mines are opened in the eastern part of the area, wastes from mining operations could enter the headwaters of streams now used for public-water supplies, unless specific measures are taken to prevent this (Kaufman, 1969).

In the Myakka River basin area, ground water is obtained both from a water-table aquifer and the artesian aquifer system. Often when adequate quantities of water are available from these aquifers, the quality of the water may not be suitable for many uses. Excessive concentrations of dissolved solids, sulfate, fluoride, or chloride are usually the factors affecting the utilization of ground-water supplies in the area. However, by careful well construction, water of suitable quality for most purposes can be obtained from most of the study area.

Large quantities of ground water of excellent quality can be obtained from all aquifers in the northeastern part of the Myakka River basin area. Small quantities of water (usually less than 50 gal/min, 1.9 l/s) of suitable quality for domestic use can be obtained from wells developed in the water-table aquifer except where saltwater intrusion has taken place near the coast and in the peninsula south and west of the Myakka River estuary.

Wells tapping artesian zones-1 at depths less than 70 ft (21 m) and -2 at depths of about 200 ft (61 m) yield water of suitable quality for domestic use in most areas except in the peninsula west of the Myakka River estuary. In some areas water from zone-2 contains fluoride and sulfate in concentrations greater than 1.6 and 250 mg/l, respectively.

The water from zone-3 at depths 250 to 450 ft (76 to 137 km) is usable for most purposes everywhere except in the peninsula southwest of the Myakka River estuary where the water contains relatively high fluoride, chloride, and sulfate concentrations, in excess of 250 mg/l.

Zones-4 at depths 500 to 700 ft (150 to 210 m) and -5 at depths of 1,000 to 1,500 ft(305 to 457 m) yield large quantities of water but except for the extreme northeastern part of the area, the sulfate and fluoride concentrations are greater than 250 and 1.5 mg/l.

Most streams in the Myakka River basin area have small drainage basins, short channel lengths, and do not yield high volumes of flow. Many streams, however, yield sufficient flow to represent a potential supply to supplement the needs of the rapidly urbanizing coastal areas. The main limiting factor is the lack of suitable impoundment sites for storing water during the annual dry season. Upper and lower Myakka lakes would provide a continuous supply of 10 Mgal/d (38 m 1/d) over a 20-year drought and 6.5 Mgal/d (25 m 1/d) over a 30-year drought if lake stages are maintained at 14 and 10 ft (4.3 and 3.0 m) above msl, respectively.

In general, the quality of surface water in the area during normal and high flows is excellent except for high color and temperatures of about 90°F (32°C) during the summer. The concentrations of sulfate, chloride, and fluoride in water of most streams sampled during the study generally met the EPA criteria for drinking water at normal and high flows. During the spring dry season, most of the flow of streams is maintained by ground water which increases the dissolved-solids, sulfate, chloride, and fluoride concentrations and hardness of the stream water. Near the coast, the chloride concentration of water in tide-affected streams is high.

About 16.5 billion gallons (70,000 million cubic metres) of ground water was used in the Myakka River basin area in 1965. This use averages about 45 Mgal/d $(2 \text{ m}^3/\text{s})$. However, because of seasonal patterns of water use, about 40 percent of the annual total use occurs during the dry spring. Sixty-four percent of total ground water use is for irrigation and 35 percent is for public and domestic water supplies. Less than 1 percent of ground water used is for industrial-commercial purposes. The use of surface water was low in 1965, averaging only about 2.5 Mgal/d $(0.1 \text{ m}^3/\text{s})$ for public water supply and pasture irrigation.

The water problems in the Myakka River basin area include flooding, inadequate or excessive drainage, inadequate supply of water of suitable quality, and deterioration of the supply by pollution and salt-water intrusion.

About one-third of the land below an altitude of 40 ft (12 m) is subject to flooding.

One of the most pressing problems in the area is the need for additional supplies of water of suitable quality to meet the requirements of a growing population. This problem could be alleviated in some areas by supplementing the ground-water supply with surface water where the topography is suitable for impoundments.

The potential exists for saltwater intrusion into freshwater aquifers in coastal areas as ground-water withdrawals increase.

The construction of saltwater canals inland has caused some localized saltwater intrusion. The intermixing of water of different quality between aquifers occurs in wells with casing driven only to the first hard-rock stratum. The well bore serves as a conduit which allows water of poor quality from one zone to intrude another zone containing water of better quality. This problem has been corrected for newly constructed and future wells as casing installation procedures stipulated by Sarasota County now require the isolation of zones containing water of poor quality.

Man-made pollution from a variety of sources has deteriorated water quality in streams and aquifers in the area. For example, effluent from public waste-treatment plants is discharged into canals and eventually reaches coastal bays and estuaries. As a result, large offshore areas have been closed to the harvest of shellfish. Runoff from agricultural lands and wastes from phosphatemining operations are potential sources of pollution.

SELECTED REFERENCES

- Applin, P. L., and Applin, E. R., 1944, Regional subsurface stratigraphy of Florida and Southern Georgia: Am. Assoc. Petroleum Geologists Bull., v. 12, p. 1680-1686.
- Barnes, H. H., and Golden, H. G., 1966, Magnitude and frequency of floods in the United States, part 2-B, South atlantic slope and eastern Gulf of Mexico basins, Ogeechee River to Pearl River: U.S. Geol. Survey Water-Supply Paper 1674, 409 p.
- Bishop, E. W., 1960, Fresh water resources of Sarasota County, Florida:

 Board of Sarasota County Commission Research Rept.
- Black, A. P., and Brown, Eugene, 1951, Chemical character of Florida's waters: Florida State Board of Conserv., Div. Water Survey,

 Research Paper 6, 119 p.
- Clark, W. E., 1964, Possibility of salt-water leakage from proposed intracoastal waterway near Venice, Florida well field: Florida Geol. Survey Rep. Inv. 38, 33 p.
- Collins, W. O., and Howard, C. S., 1928, Chemical character of waters of Florida: U.S. Geol. Survey Water-Supply Paper 596-G, 56 p.
- Cooke, C. W., 1945, Geology of Florida: Florida Geol. Survey Bull. 29, 339 p.
- Dalymple, T., 1960, Flood-frequency analyses: U.S. Geol. Survey Water Supply Paper 1543-A.
- Eppert, H. C., 1966, Stratigraphy of the Upper Miocene deposits in Sarasota County, Florida: Tulane Studies in Geology, v. 4, no. 2, p. 49-61.

- Ferguson, G. E., and Lingham, C. W., Love, S. K., and Vernon, R. O., 1947, Springs of Florida: Florida Geol. Survey Bull. 31, 196 p.
- Flippo, H. N., Jr., and Joyner, B. F., 1968, Low streamflow in the Myakka River basin area in Florida: Florida State Board of Conserv., Div. of Geology, Rept. Inv. 53, 34 p.
- Florida State Board of Health, 1960, Some physical and chemical characteristics of selected Florida waters, Jacksonville, Florida State Board of Health, 108 p.
- Florida State Board of Health, 1964, Some physical and chemical characteristics of selected Florida waters (a supplement):

 Jacksonville, Florida State Board of Health, 54 p.
- Joyner, B. F., and Sutcliffe, H., Jr., 1967, Salt-water contamination in wells in the Sara-Sands area in Siesta Key, Sarasota County, Florida: Am. Water Works Assoc. Jour., v. 59, no. 12, p. 1504-1512.
- Kaufman, Matthew I., 1969, Generalized distribution and concentration of orthophosphate in Florida streams: Florida Bureau of Geol. Map Series No. 33.
- Kohler, M. A., Nordenson, T. J., and Baker, D. R., 1959, Evaporation maps of the United States: U.S. Weather Bureau Tech. Paper 37.
- Lichtler, W. F., Anderson, W., and Joyner, B. F., 1964, Interim report of the water resources of Orange County, Florida: Florida Geol Survey Inf. Circ. 41, 50 p.
- MacNeil, F. S., 1949, Pleistocene shore lines in Florida and Georgia:
 U.S. Geol. Survey Prof. Paper 221-F, 106 p.

- Miller, J. F., 1944, Two to ten-day precipitation for return periods of 2 to 100 years in the contiguous United States: U.S. Weather Bur. Tech. Paper 49.
- National Academy of Sciences and National Academy of Engineering, 1973,

 Water quality criteria 1972 (U.S.) Environmental Protection

 Agency rept. EPA R3 73 033, 594 p.
- Parker, G. G., and Cooke, C. W., 1944, Late Cenozoic geology of southern Florida, with a discussion of the ground water: Florida Geol. Survey Bull. 27, 119 p.
- Parker, G. G., Ferguson, G. F., Love, S. K., and others, 1955, Water resources of southeastern Florida: U.S. Geol. Survey Water-Supply Paper 1255, 965 p.
- Peek, H. M., 1958, Ground-water resources of Manatee County, Florida:
 Florida Geol. Survey Rept. Inv. 18, 99 p.
- Peek, H. M., 1958a, Records of wells in Manatee County, Florida:
 Florida Geol. Survey Inf. Circ. 19, 199 p.
- Pride, R. W., 1973, Estimated use of water in Florida, 1965, Florida Geol. Survey Map Series 36.
- Smally, Wellford and Nalvin, 1961, Sarasota County coastal basins flood-control study: Board of Sarasota County Commissioners, 98 p.
- Smally, Wellford and Nalvin, 1963, Water supplies of Sarasota County:

 Board of Sarasota County Commissioners, 122 p.

- Smith and Gillespie, 1960, Interim report on ground-water studies for Sarasota, Florida: City of Sarasota, 20 p.
- Stewart, H. G., 1966, Ground-water resources of Polk County, Florida: Florida Beol. Survey Rept. Inv. 44, 170 p.
- Stringfield, V. T., 1933, Ground-water investigations in Florida: Florida Geol. Survey Bull. 11, p. 1-33.
- Stringfield, V. T., 1936, Artesian water in the Florida peninsula:
 U.S. Geol. Survey Water-Supply Paper 773-C, p. 115-195.
- Stringfield, V. T., 1966, Artesian water in Tertiary Limestone in the southeastern states, U.S. Geol. Survey Prof. Paper 517, 226 p.
- Sutcliffe, H., Jr., and Joyner, B. F., 1966, Packer testing in water wells in Sarasota County, Florida: Ground water, v. 4, no. 2 p. 23-27.
- Sutcliffe, H., Jr., and Joyner, B. F., 1968, Test well exploration in the Myakka River basin area, Florida: Florida State Board of Conserv. Div. of Geology Inf. Circ. 56, 61 p.
- U. S. Army Corps of Engineers, 1961, Analysis of hurricane problems in coastal areas of Florida: U.S. Army Corps of Engineers, Jacksonville.
- U. S. Soil Conservation Service, 1961, Work plan for Sarasota West Coast Watershed: U.S. Dept. Agriculture.
- U. S. Soil Conservation Service, 1965, Work plan for Big Slough watershed: U.S. Dept. Agriculture.
- Wander, I. W., and Reitz, H. J., 1951, The chemical composition of irrigation water used in Florida sitrus groves: Florida Univ. Agr. Exp. Sta. Bull. 480, 7 p.

In this report, wells are referred to by a local number, serially from 1 through 67. The U.S. Geological Survey Site Identification Number is a 15-digit number based on the latitude and longitude coordinates of the well site. The table below shows the Site Identification number for each well mentioned in this report.

WELL AND SITE IDENTIFICATION NUMBERS

```
264323N0821530.1
                         23.
                               271118N0822853.1
                                                   45.
                                                        272022N0822312.1
     264923N0820137.1
                         24.
                              271134N0820922.1
                                                   46.
                                                        272034N0821452.1
 3.
     265017N0821537.1
                         25.
                                                   47.
                              271134N0820922.2
                                                        272036N0822846.1
 4.
     265557NO821522.1
                         26.
                              271135N0822802.1
                                                   48.
                                                        272041N0823223.1
     265612NO821104.1
                         27.
                                                   49.
                              271213N0820559.1
                                                        272047N0821144.1
 6.
     265713N0822057.1
                         28.
                              271213N0822908.1
                                                   50.
                                                        272047N0822915.1
 7.
     265742N0822103.1
                         29.
                              271420N0822257.1
                                                   51.
                                                        272054N0822936.1
8.
     265922N0820456.1
                         30.
                              271456N0822309.2
                                                   52.
                                                        272102N0821006.1
9.
     265944N0821754.1
                         31.
                              271608N0822802.1
                                                        272122N0823308.1
                                                   53.
                         32.
                              271611N0820502.1
10.
     270133N0820346.1
                                                   54.
                                                        272128N0822003.1
11.
     270133N0820346.2
                         33.
                               271614N0823043.1
                                                   55.
                                                        272256NO821635.1
12.
                               271659N0823130.1
     270137N0822353.1
                         34.
                                                   56.
                                                        272258NO821953.1
13.
     270247N0821619.1
                         35.
                               271757NO822413.1
                                                   57.
                                                        272301N0821941.1
14.
                               271821N0821551.1
                                                        272308N0821618.1
     270422N0822447.1
                         36.
                                                   58.
15.
     270542N0822616.1
                         37.
                               271827N0822024.1
                                                   59.
                                                        272356N0821813.1
     270542N0822618.1
                         38.
                               271832N0820648.1
                                                   60.
                                                        272438NO823252.1
17.
     270714N0821552.1
                         39.
                              271832N0820648.2
                                                   61.
                                                        272523NO820336.1
18.
     270728N0822328.1
                         40.
                              271922N0823407.1
                                                        272706NO822255.1
                                                   62.
19.
     270731NO822714.1
                         41.
                              271938NO822518.1
                                                   63.
                                                        272728NO821515.1
20.
     270927N0820609.1
                         42.
                              272004N0822818.2
                                                   64.
                                                        272731NO820546.1
21.
                         43.
                               272007N0821753.1
                                                   65.
                                                        272735N0820834.1
     270931N0822529.1
22.
     270938N0820756.1
                               272021N0823536.1
                                                        272938N0820834.1
                         44.
                                                   66.
                                                        273307NO820351.1
                                                   67.
```

UNITED STATES DEPARTMENT OF THE INTERIOR GEOLOGICAL SURVEY
325 John Knox Rd--Suite F240
Tallahassee, Florida 32303

POSTAGE AND FEES PAID U.S. DEPARTMENT OF THE INTERIOR INT. 413



FIRST CLASS