

The lake assessments are created in partnership with Hillsborough County and the Florida Center for Community Design and Research

LAKE ASSESSMENT DOCUMENT

Crescent Lake 10/2/98 Watershed: Brooker Creek

Lake assessments are being conducted to contribute physical and ecological data to the Atlas as a collaborative effort between project partners. The goal is to rapidly assess many of the lakes in the county and thus provide stakeholders a better understanding of the character of the lake, its shore, and the aquatic plants present there. These data are intended to assist in the future management of the lake and its watershed.

The first section of the report provides the results of the bottom mapping effort: a contour (bathymetric) map of the lake, area, volume and depth statistics, and the water level at the time of assessment (if available).

The second section provides the results of the ecological (vegetation) assessment conducted on the lake. These results can be used to better manage vegetation in your lake. A list is provided with the different plant species found at various sites around the lake. Potentially invasive, exotic (non-native) species are identified in a plant list and the percent of exotics is presented in a summary table. The results of this study are compared with other lakes in the watershed.

The intent of the assessment is to provide a starting point from which to track changes in your lake. These data can provide the information needed to determine changes and to monitor trends in physical condition and ecological health of the lake.

I. Physical Data – Area, Depth, Volume, & Bottom Contours

The bottom of the lake was mapped using a sophisticated Global Positioning System (GPS) to determine the boat's position, and a depth-finder to provide depth associated with that measured position. The result is an estimate of your lake's area, mean and maximum depths, and volume (Table 1) and the creation of a bottom contour map.

Table 1. Physical Characteristics of Your Lake.

Surface Area (acres):	51
Mean Depth (feet):	9.8
Maximum Depth (feet):	24.0
Volume (gallons):	163,559,378

Crescent

Section-Township-Range 3-27-17 10-27-17

Lake

Contour Lines
Expressed in
2- Foot Intervals Lake Perimeter ground level


above Mean Sea Level when the lake was surveyed. Contours are expressed in absolute depth Lake water level was 42.05 ft

ထ

62

9/

Community Design and Research based on survey data provided by the Hillsborough County Lake Management Program.

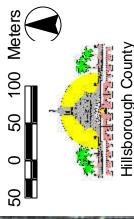

91






EXPLANATION: Survey date October 2, 1998.

Explanation:

below this level.

DATA SOURCES:
Digital orthophotos by United States
Geological Survey. All contours
generated by Florida Center for

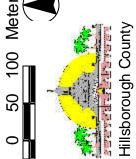



The lake assessments are created in partnership with Hillsborough County and the Florida Center for Community Design and Research

LAKE ASSESSMENT DOCUMENT

Crescent Lake 10/2/98 Watershed: Brooker Creek

II. Ecological Data

Aquatic Plant Survey

Approximately equispaced sites are haphazardly mapped around the lake and the aquatic plants at each site are surveyed. The total number of species from all sites is used to approximate the total diversity of aquatic plants and the percent of invasive-exotic plants on the lake and in the watershed (Table 2). Many of these plants are considered ecologically harmful, as they tend to out-compete native species. Such "nuisance" plants can also make boating and other recreational activities difficult or impossible. The common and scientific names of plant species found on your lake are listed in Table 3.

Table 2. Comparison of species diversity between your lake and other assessed lakes located within your watershed.

	Crescent Lake	Brooker Creek	
		(Average)	
Number of Taxa:	43	31	
Percent Exotic Plants:	12%	14%	

Table 3. Botanical and common names of the most commonly found plants on your lake. Percent frequency (of occurence), habit (location where found), status (native or exotic), and EPPC status are provided.

Common Name	Plant Species	Frequency	Habit	Status	EPPC
Torpedo Grass	Panicum repens	100%	Emergent	Exotic	1
Water Primroses, Primrosewillow	Ludwigia spp.	90%	Emergent	Unknown	NL
Water Spangles, Water Fern	Salvinia minima	90%	Floating	Native	NL
Bladderwort	Utricularia spp.	90%	Submersed	Native	NL
Pickerel Weed	Pontederia cordata	80%	Emergent	Native	NL
Climbing Hempvine	Mikania scandens	70%	Emergent	Native	NL
Spatterdock, Yellow Pondlily	Nuphar lutea var. advena	70%	Floating	Native	NL
Alligator Weed	Alternanthera philoxeroides	60%	Emergent	Exotic	II
Baldwin's Spikerush, Roadgrass	Eleocharis baldwinii	60%	Submersed	Native	NL
Punk Tree, Melaleuca	Melaleuca quinquenervia	60%	Emergent	Exotic	1
Southern Red Maple	Acer rubrum var. trilobum	50%	Emergent	Native	NL
Water Purslane	Didiplis diandra	50%	Submersed	Unknown	NL
Wax Myrtle	Myrica cerifera	50%	Emergent	Native	NL
Pine Tree	Pinus spp.	50%	Emergent	Native	NL
Dahoon Holly	llex cassine	40%	Emergent	Native	NL
Algae	Periphyton spp.	40%	Submersed	Native	NL

Crescent Lake 10/2/98 Watershed: Brooker Creek

Willow	Salix spp.	40%	Emergent	Native	NL
Swamp Fern	Blechnum serrulatum	30%	Emergent	Native	NL
Water Hyacinth	Eichhornia crassipes	30%	Floating	Exotic	1
Stream Bog Moss	Mayaka fluviatilis	30%	Submersed	Native	NL
American White Water Lily, Fragrant Water	Nymphaea odorata	30%	Floating	Native	NL
Maidencane	Panicum hemitomon	30%	Emergent	Native	NL
Algal Mats, Floating	Algal spp.	20%	Floating	Unknown	Unknow
Buttonweed	Diodia virginiana	20%	Emergent	Native	NL
Manyflower Marshpennywort, Water Penny	Hydrocotyl umbellata	20%	Emergent	Native	NL
Creeping Primrosewillow, Red Ludwigia	Ludwigia repens	20%	Emergent	Native	NL
Watergrass	Luziola fluitans	20%	Emergent	Native	NL
Sweetbay Magnolia	Magnolia virginiana	20%	Emergent	Native	NL
Southern Waternymph	Najas guadelupensis	20%	Submersed	Native	NL
Pond Weed	Potamogeton spp.	20%	Submersed	Unknown	NL
Laurel Oak; Diamond Oak	Quercus laurifolia	20%	Emergent	Native	NL
Filamentous Algae, Algal Mats	Algae, Filamentous	10%	Floating	Native	NL
Bur Marigold	Bidens spp.	10%	Emergent	Native	NL
Fanwort	Cabomba caroliniana	10%	Submersed	Native	NL
Sedge	Cyperus spp.	10%	Emergent	Unknown	NL
Southern Wood Fern	Dryopteris Iudoviciana	10%	Emergent	Native	NL
Loblolly Bay	Gordonia lasianthus	10%	Emergent	Native	NL
Morning Glory	Ipomoea spp.	10%	Emergent	Unknown	NL
Stonewort	Nitella spp.	10%	Submersed	Native	NL
Water Oak	Quercus nigra	10%	Emergent	Native	NL
Burhead Sedge,Cuban Scirpus	Scirpus cubensis	10%	Emergent	Native	NL
Cypress	Taxodium spp.	10%	Emergent	Native	NL
Caesar's-weed	Urena lobata	10%	Emergent	Exotic	II

Standing Crop

In addition to an overall survey of the types of plants on a lake, an estimate of the standing crop (biomass) of the lake has been obtained for many lakes. This was done by calculating the average weight of the vegetation within a quarter-meter square quadrat tossed haphazardly into three zones (see Figure) at each sampling site around the lake: (1) the emergent zone, (2) the floating zone and (3) the submersed zone. The average weight of the plants (Table 4) from all sampling sites and the dominant type of vegetation (Table 5) are provided. If data tables are not shown, no standing crop estimates were obtained for this lake.

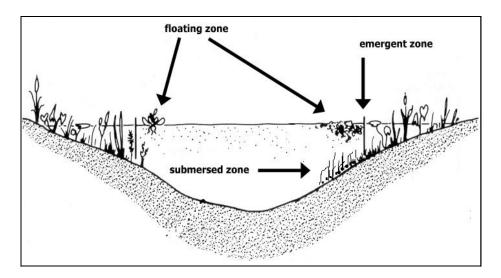


Table 4. Comparison between the average biomass from three zones within your lake and among all lakes assessed within your watershed.

	Crescent Lake	Brooker Creek	
		(Average)	
Emergent Zone:	5.99	3.71	
Floating Zone:	1.94	0.82	
Submersed Zone:	1.21	1.63	

Number of lakes sampled in your watershed: 25

Note: All biomass measurements are shown in kilograms per square meter.

Table 5. Dominant taxa from three zones within your lake.

<u>Zone</u>	Dominant Plant	<u>Status</u>
Emergent Zone:	Torpedo Grass	Exotic
Floating Zone:	Spatterdock, Yellow Pondlily	Native
Submersed Zone:	Bladderwort	Native